

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

#1517

For corners in

<u>Missaukee County</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>23N</u> R <u>6W</u>	<u>M-9</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

LIBER 315 PAGE 1120
 MISSAUKEE COUNTY MICHIGAN
 RECORDED DEC 29 1997 ^{1:25} P.M.
Carolyn Flare
 REGISTER
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Daniel E. Schripsema, in a field survey on October 1, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- M-9) 1839 GLO survey set post corner sections 24, 25; Sugar 22 S23W 27, do 10 N43W 22 1913 corner shown but no witnesses or comment
- 1976 Frederick H. Thomson LCRC, #204; Fd. 1/2" iron rod
- 1976 Frederick H. Thomson survey, liber S-1, pg. 295; Fd. 1/2" iron rod N45W Fe. Cor. Post 46.25', N20W 8" Elm 48.70', N60E Pipeline Marker 74.2', South 1/2" iron 33.0'
- 1977 Frederick H. Thomson survey, liber S-1, pg. 341; same as rec. liber 1, pg. 295
- 1978 Frederick H. Thomson survey, liber S-1, pg. 440; Fd. 1/2" Iron rod N45W CF Post 46.25', N20W 8" Elm 48.70'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- M-9) Corner Common to Sections 24 & 25, T23N, R6W, and Sections 19 & 30, T23N, R5W. Found 1/2" iron rod/ cap in centerline E&W road and 3' east of centerline road north, field line to the South is 6' west of corner to.
- This corner is accepted as a careful and faithful perpetuation of the position of the original corner.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- M-9) Set Missaukee County Monument on existing rerod
- N43W 46.29' corner fence post *
- N11E 68.98' 8" elm
- S03E 30.44' Center gas line marker
- S27E 108.05' 9" white pine

Peer Group Reviewed and Approved
 Date 12-18-97
J. Dean Geers
 J. Dean Geers, Missaukee Co. Representative

Signed by Daniel E. Schripsema
 Surveyor's Michigan License No. 24617

Date 12-2-97

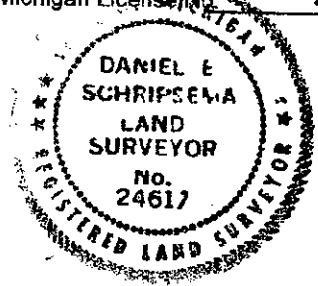

SURVEY & REMONUMENTATION

JAN 16 1998

SECTION

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983
 REVISED OCT., 1995