


LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: <u>Missaukee</u> (County)	Located In _____	Corner Code # _____	
1. Public Land Survey	T _____ R _____	_____	_____
	T _____ R _____	_____	_____
2. Property Controlling in Section	S <u>18</u> T <u>23N</u> R <u>7W</u>	<u>15</u>	
	S <u>18</u> T <u>23N</u> R <u>7W</u>	<u>8</u>	
3. Miscellaneous Property in Section	S _____ T _____ R _____	_____	_____
	S _____ T _____ R _____	_____	_____
4. Lot No: _____	Recorded Plat: _____		
5. Private Claims: _____			

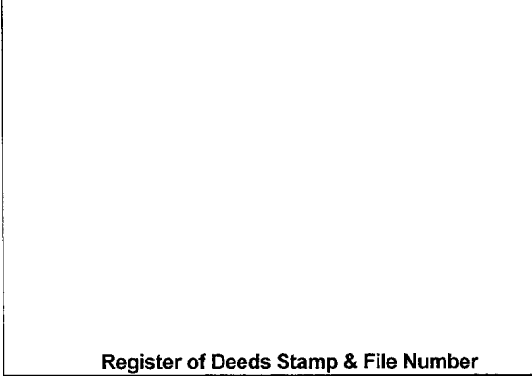

I, Craig W. McVean, in a field survey on Dec. 16, 2009 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		● 18		17		16		15		14		13	
7		●											
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

- | | |
|--|--|
| <p><u>15</u> – 1892-1914 – E. A. Beuthien, County Surveyor Record, FB #35, p. 55
 1) Blk. Oak S33°E 114
 2) WPS 40 N10°E 52
 - 1974 – Recorded Survey, L. S-1, p. 184 – James Granger – Iron set</p> | <p><u>8</u> – 1911 – County Surveyor Record – FB #14, p.78
 Cedar stake –
 1) Cedar tree N. 21</p> |
|--|--|

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- | | |
|--|---|
| <p><u>15</u> – W 1/16 corner common to Sections 18 & 19 – Found 1/2" x 24" capped Granger iron #16041 that fits proper proportional position for corner. Also found both Beuthien witnesses that fit a position that is S67°E 6.76' from the Granger iron. Dug and searched for evidence of stake, but nothing found. Appears that Beuthien had a measurement error. No real occupation N or S from Beuthien position. Accepted 1/2" x 24" CIR as best available evidence of the position of the corner.</p> | <p><u>8</u> – CW 1/16 Corner Section 18 – No evidence of county surveyor BT or stake. Set a stamped 2" aluminum cap on a 5/8" x 34" rebar per standard BLM procedure.</p> |
|--|---|

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|--|---|
| <p><u>15</u> – Replaced 1/2" x 24" Granger iron with a stamped 2" Aluminum cap on 5/8" x 34" rebar
 N68°W 14.78' to set nail & tag in SW side 21" Oak
 S49°W 20.73' to set nail & tag in NW side 8" Oak
 N21°E 35.14' to set 60 d nail in centerline 40" WPS (#2)
 S36°E 81.09' to set nail & tag in NE side 40" Black Oak (#1)
 SW 0.5' to 1" Hex iron up 2.0'
 NE 0.5' to face 4" iron pipe, up 1.5'
 Set Blue Carsonite Post with location tag 1' South
 S8°E 33.28' to set N & T in W. side Tw. 11" & 8" R. Maple
 S67°E 6.76' to Spike set at apparent Beuthien position.</p> | <p><u>8</u> – CW 1/16 Section 18 – Stamped 2" Aluminum Cap on 5/8" x 34" rebar
 S43°E 11.45' to set nail & tag in NE side 4" Red Maple
 S53°W 15.54' to set nail & tag in NW side 5" Cherry
 North 22.78' to set nail & tag in E. side 7" Spruce
 N57°E 28.14' to set nail & tag in NW side 6" Balsam Fir
 Set Blue Carsonite Post with location tag 1' Northeast</p> |
|--|---|

Signed by: Craig W. McVean
 Surveyor's Michigan License No.: 39088

Date: 6/1/2010

