

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In: Missaukee Located In _____ Corner Code # _____
(County)


1. Public Land Survey	T _____	R _____		
	T _____	R _____		
2. Property Controlling in Section	S <u>18</u>	T <u>23N</u>	R <u>7W</u>	<u>11</u>
	S <u>18</u>	T <u>23N</u>	R <u>7W</u>	<u>12</u>
3. Miscellaneous Property in Section	S _____	T _____	R _____	
	S _____	T _____	R _____	

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

I, Craig W. McVean, in a field survey on Dec. 15, 2009 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

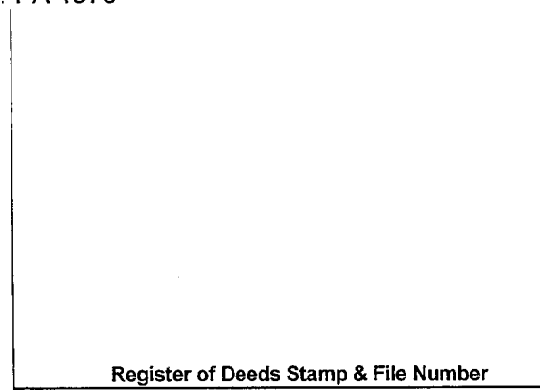

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7	●	●											
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

11 – 1974 – Recorded Survey - L. S-1, p. 184
James H. Granger – Set iron

12 – 1974 – Recorded Survey - L. S-1, p. 184
James H. Granger – Set iron

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

11 – SW 1/16 Corner Section 18 – Found 1/2" X 24" rebar with broken plastic cap per Granger. 1/2" x 24" rebar accepted as best available evidence of the position of the corner.

12 – CS 1/16 Corner Section 18 – Found 4" iron pipe but no evidence of Granger's 1/2" CIR. Set 2" stamped Aluminum cap on 5/8" x 34" rebar per standard BLM procedure.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

11 – SW 1/16 Section 18 – Replaced 1/2" x 24" rebar with a Stamped 2" Aluminum cap on 5/8" x 34" rebar
North 47.85' to set nail & tag in W. side 11" Cherry
S68°E 22.49' to set nail & tag in S. side 9" Spruce
S08°W 8.10' to set nail & tag in E. side 4" Red Maple
S85°W 21.88' to set nail & tag in N. side twin 7" Cherry
East 0.7' to 4" iron pipe, up 2.0'
Set Blue Carsonite Post with location tag 1' Northeast

12 – CS 1/16 Section 18 – Stamped 2" Aluminum cap on 5/8" x 34" rebar
N09°W 17.54' to set nail & tag in E. side 10" Fir
N57°W 19.73' to set nail & tag in NE side 9" Cherry
S37°W 22.61' to set nail & tag in E. side 16" Spruce
S67°E 5.83' to set nail & tag in N. side 6" Cherry
S56°W 1.7' to face of found 4" pipe
Set Blue Carsonite Post with location tag 1' Northwest

Signed by: Craig W. McVean
Surveyor's Michigan License No.: 39088

Date: 6/1/2010

