

SURVEY & REMONUMENTATION

JAN 16 1998

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

#1184

SECTION
For corners in

<u>Missaukee</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 24N R 8W	L-13
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

LIBER 314 PAGE 1265

MISSAUKEE COUNTY MICHIGAN
NOV 10 1997 4:30 pm

Paula Fla...

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, J. Dean Geers, in a field survey on June, 19 97 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- L-13) 1838 GLO Quarter Section Post by John Brink, Deputy Surveyor; Beech 10-N62E-18, Hemlock 12-N61½W-26
- L-13) 1967 MDOT LCRC, Liber 1, Page 314; Found 1" Pipe in line with fence North and South S34W-31.68-Fence Post, S61E-60.70-Fence Post, N15E-79.81-4" Pine, N72E-79.23-35" Balm of Gilead

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- L-13) Quarter Section Corner common to Section 36, T24N, R8W and Section 1, T23N, R8W; Found 1" Pipe as recorded in Liber 1, Page 314. Corner is ±3' South of centerline East-West road and on old down fence to South. This corner is accepted as the best available evidence of the position of the original corner. Also Found 1" Pipe in centerline of East-West road approximately 15.45' Northeasterly of other 1" Pipe. This corner appears to have been set midway and on line between the Southwest and Southeast Corners of Section 36. This corner is not utilized in this survey.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


- L-13) Found 1" Pipe and raised with ½" Iron and Missaukee County Monument
 - S30E 80.88 4" White Pine
 - N15E 79.51 16" Red Pine
 - N05E 67.98 Set Iron
 - S05W 60.54 Set Iron
 - N70E 15.45 Found Pipe

Peer Group Reviewed and Approved

Date: 10-15-97

J. Dean Geers
J. Dean Geers, Missaukee Co. Representative

Signed by _____
Surveyor's Michigan License No. 3977

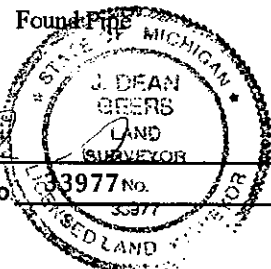

Date 10-22-97