MAY 1 6 1997

For corners in

expressed below:

## MANAGE MANAGE

## Montmorency County Remonumentation

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN MONTMORENCY COUNTY Recorded & Filed

09-27-1996 13:24:38

_	Montmorency	Located In:	Corner Code ##	A. PANGAN-MCELROY
	(County)	Rust Township		REGISTER OF DEEDS
1.	Public Land Survey	T 29N R 4E	D-13	
		T R		ADDON OFTO
		T R	<del></del>	Liber Liber Rase Hook
		T R		_
2.	Property Controlling	S T R		
	in Section	S	<del></del>	00019 0100
3.	Miscellaneous	S R		Register of been seember File Number
	Property in Sec.	S		
4.	Lot No ,	Recorded Plat		A B C D E F G H I J K L I
5.	Private Claims			
				2 f 6 f f f f f f f f f f f f f f f f f
				3 <del>-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1</del>
1	annu C. Baaumagand		June 00	⁴├─ ┆ <del>─</del> ┼─ ┆─┼─ ┆─┼─ ┆─┼─ ┆─┼─ ┆
		_ , in a field survey on		
		requirements of P.A. 74, Michigan P.A. in conformance with regulations an		
		structions of the United States Depart		
		of a Court of Law and/or that the corne		
		with the rules of the Michigan Board o	•	
Co	urt of Law; established,	re-established, monumented, re-n	nonumented, recovered, toun	nd as

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

D-13 South 1 corner Section 32.

A. Description of original monument and accessories and/or subsequent restoration:

Nov. 1839 - Original post set by Lewis Clason D.S. wit's marked: (N 53° E 44 links 5" Black Oak) (N 17° W 4 links 3" Aspen).

1913 - C.O. Seeley Oscoda Co, Surveyor set post by S.P. wit's marked. NBT B. Oak 15" (N 40°-30' W .76).

June 1981 - Norm Caldwell P.S. # 12018 found 3/4" pipe & remains of wood stake by Seeley, then set Oscoda Co. std.

corner. Filed LCRC Rec. L. 1, P. 297. Wit's marked & found (N 40° W 50.2' found remains of NBT by Seeley)


(N 10° E 6.0' 12" R. Oak) (S 30° E 14.7' 12" R. Oak) (S 30° W 27.2' 12" R. Oak) (N 45° W 1.0' DNR Post).

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found Oscoda Co. std. corner set by Caldwell in good condition, with DNR post & location marker along side.

Replaced with 4" dia. x 36" conc. mon. & Re-mon cap # 18654.

West 23.49' Oscoda Co. std. corner. N 1 corner Section 5, T 28N, R 4E.

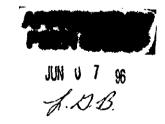

SURVEYO

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D-13 South ‡ corner Section 32.

4" dia. x 36" conc. mon. & Re-mon cap # 18654. Accepted as a careful and faithful establishment of the position of the corner. Approved by the Peer Group on June 7, 1996.

S 35° W 60.18' 11" Oak NBT

N 85° W 28.10' 9" Oak "

N 35° W 26.38' 5" Oak "

N 15° E 5.65' 12" Oak "

Placed 60d penny spike, P.S. tag # 18654 & blaze. (typ)

	OVAL .
Signed by Kany & Beausegard	Date 9-24-96
	•
Surveyor's Michigan License No18654	FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 197: REVISED MAY 14, 1975