

SECTION

193510004 JA-599001698

JA-5990016

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Table with columns: County (Oakland), Located in: Lyon Township, Corner Code #. Rows include Public Land Survey, Property Controlling in Section, and Miscellaneous Property in Sec.

\$ 7.00 MISCELLANEOUS RECORDING
\$ 2.00 REMONUMENTATION
5 JAN 99 8:00 A.M. RECEIPT# 8A
DAVID L. ... OAKLAND COUNTY
DAVID L. ...
COMPLIANCE with
ACT 345, P.A. 1990

APPROVED ON: 12-16-98 53
OAKLAND COUNTY REMONUMENTATION
PEER GROUP COMMITTEE
Register of Deeds Stamp & File Number

- 4. Lot No. ... Recorded Plat
5. Private Claims

I, Bruce Antcliff, in a field survey on November 4, 1998, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Table with columns: Corner Code, Date, Description, Monument Type. Includes entries for 1816, 1963, 1966, 1976, 1986, 1989, 1993, 1996, and N/A.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-2 This corner falls on bridge deck over I-96 and corner has been destroyed. Using 60' West of found monumentation along the East right-of-way of South Hill Road from Pine Ridge Club (L. 249 P. 20) set points on West line of Section 2. Using these points and the Northwest corner of Section 2, extended line South (Record dist.) 658.12' from Southwest corner of Pine Ridge Club. This point falls 0.5' West of the C/L joint of bridge and is on a straight line between I-1 and I-3. Meas. North to Northwest corner Section checks MDOT 0.65' + and South to Southwest corner Section checks MDOT 0.85' + but does not check Boss Survey within 3' +/-

Measure North 3302.3' to I-1 (G.L.O. = 3300.0') (MDOT (1966) = 3301.65') (Pine Ridge Club = 3310.64')
(Boss Survey (1989) = 3306.15') (Boss Survey (1993) = 3305.93')
Measure South 2646.6' to I-3 (G.L.O. = 2640.0') (MDOT (1966) = 2645.75')(Grand River Estates = 2645.52')

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-2 Set Chiseled "+" in Concrete Bridge Deck


- PK Nail & Oakland Co. Remonumentation Tag in Top Guard Post N 09° E 99.86'
PK Nail & Oakland Co. Remonumentation Tag in Top Guard Post N 08° W 113.66'
PK Nail & Oakland Co. Remonumentation Tag in Top Guard Post S 08° W 103.39'
PK Nail & Oakland Co. Remonumentation Tag in Top Guard Post S 08° E 117.22'
PK Nail & Oakland Co. Remonumentation Tag in W side 12" Oak S 20° W 227.39'
PK Nail & Oakland Co. Remonumentation Tag in S side 18" Cherry S 90° W 272.79'
PK Nail & Oakland Co. Remonumentation Tag in S side 8" Oak N 37° W 290.67'
PK Nail & Oakland Co. Remonumentation Tag in N side 36" Oak N 90° E 279.20'

The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

Signed by Bruce Antcliff Date 12-22-98

EARTH TECH

Surveyor's Michigan License No. 25826

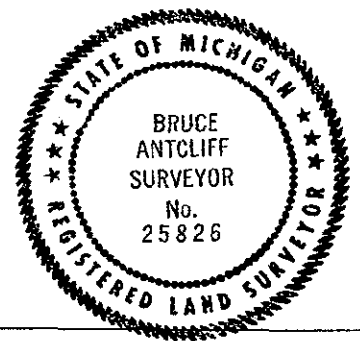

700 FILE
200 FILE