

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

_____ Oakland _____ Located In: _____ Corner Code # _____
 (county)

1. Public Land Survey T 2N R 8E _____ E-10 _____
 T _____ R _____
 T _____ R _____
 T _____ R _____

2. Property Controlling S _____ T _____ R _____
 in Section S _____ T _____ R _____

3. Miscellaneous S _____ T _____ R _____
 Property in Sec. S _____ T _____ R _____

\$ 7.00 MISCELLANEOUS RECORDING
 \$ 2.00 REMONUMENTATION
 26 DEC 96 9:25 A.M. RECEIPT# 7B
 PAID RECORDED - OAKLAND COUNTY
 LYNN D. ALLEN, CLERK/REGISTER OF DEEDS

Compliance with
 ACT 345, P.A. 1970
 APPROVED ON: 11-25-96 JS
 OAKLAND COUNTY REMONUMENTATION
 PEER GROUP COMMITTEE
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, James E. Kovas, in a field survey on November 25, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	16		17		18		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 E-10

1816 - G.L.O. Set 1/4 Post WIT: N41E 20 Lks. Tamarack; N79W 11 Lks. Tamarack;
 1899 - F.A.Slater, 8" Tamarack Stub; 1978 - "Court of Highgate" (Liber 159 Plats, Page 34), no accessories; 1993 -
 B.F.Thompson, LCRC (Liber 13950, Page 648) 1/2" Iron WIT: S75°W 43.81' Dbl Hd Nail N.Face 4" Oak; S55°W 24.82' Dbl Hd
 Nail NW Face 4" Mulberry; S30°W 36.19' Dbl Hd Nail w/BFT Flasher E.Face Dbl Maple; S85°E 27.47' 16d Nail w/BFT Flasher
 N.Face 6" Dead Tree; 1994 - "Loon Lake Woodlands No.1" (Liber 233 Plats, Page 6) Refers to Liber 13950, Page 648 for
 accessories; 1995 - Bishop, LCRC (Liber 15296, Page 394) Iron in Swamp WIT: S72°W 43.71' Nail N.Face 4" Oak; S55°W
 24.82' Nail NW Face 4" Mulberry; S30°W 36.19' Nail/ Flasher E.Face 10" Maple; S85°E 27.47' P.K.Nail/ Flasher N.Face 6"
 Dead Tree; N55°W 48.45' P.K.Nail NE Face 24" Maple
 Distances: E-10 to E-9 = 2640.00' (GLO); 2690.82' (Slater); 2640.26' (Wade-Trim)
 E-10 to E-11 = 2640.00' (GLO); 2651.84' (Wade-Trim)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-10 Found 1/2" Iron in Swamp

WIT: S55°W 24.82' Fnd Dbl Hd Nail NW Face 4" Mulberry
 N55°W 48.45' Fnd P.K. Nail NE Face 24" Maple
 South 6.5' Fence Intersection (Broken Down) N-S-W


The 1/2" Iron found was ratified by the Peer Review Committee on November 25, 1996, as the accepted corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-10 Set Concrete Monument with Brass Oakland Co. Remonumentation Cap # 33138, in Swamp, at location of 1/2" Iron.

WIT: N50°W 48.41' Set 60d Nail/ Oakland Co. Remon Tag# 33138 E.Face 16" S.Maple
 S70°E 33.05' Set 60d Nail/ Oakland Co. Remon Tag# 33138 E.Face 10" Elm
 S75°W 43.55' Set 60d Nail/ Oakland Co. Remon Tag# 33138 NE Face 6" Maple
 S55°W 24.76' Fnd Dbl Hd Nail/ Tag# 23828 NW Face 4" Mulberry
 East 6.6' Fence Corner (E-W-S)

*700 FILE
 200*

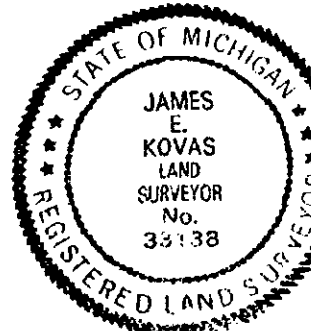

Signed by James E. Kovas Date December 20, 1996