

SURVEY & REMONUMENTATION

LIBER. **15288** PG **509**

MAR 10 95 04 04 23

MAY - 1 1995

LAND CORNER RECORDATION CERTIFICATE 7.00 MISC RECORDING CHG - IN HOUSE
 Filing Requirement of Act 74, Mich. P.A. 1976 2.00 REMON CHG - IN HOUSE
 Commerce Twp.

10 MAR 95 4:02 P.M. RECEIPT# 1778
 PAID RECORDED - OAKLAND COUNTY
 LYNN D. ALLEN, CLERK/REGISTER OF DEEDS

For corners in **COMMISSION**
 Oakland

(County)	Located In:	Corner Code #
1. Public Land Survey	T <u>2N</u> R <u>8E</u>	<u>I-3</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____


Compliance with ACT 345, P.A. 1990
 12-5-94
 APPROVED ON: _____
 OAKLAND COUNTY REMONUMENTATION PEER GROUP COMMITTEE
OK - T. SMITH
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

David Pawlaczyk December 1 94

I, _____, in a field survey on _____, 19 _____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

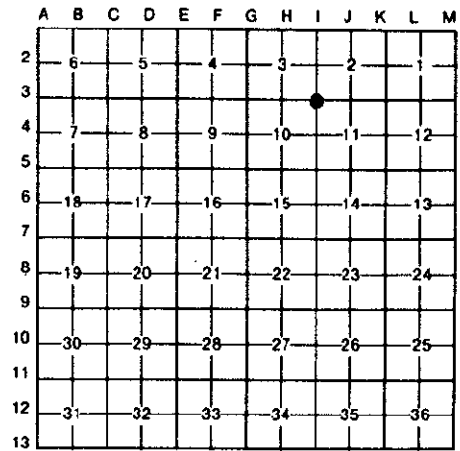

A. Description of original monument and accessories and/or subsequent restoration:

Date	Description	Surveyor	Accessories	Notes
1815	Post	G.L.O. A. Holmes	N/A	Notes
1975	3/4" Iron	L.C.R.C. E. Anderson	#11495	L6462 P886
1979	1/2" Iron in monument box	L.C.R.C. D. Finney	#15536	L7580 P812
1979	Iron rod in section corner well	L.C.R.C. G. Heil	#18993	L7590 P42
1984	Boat spike in monument box	Survey J. Bishop	#25829	L8784 P640

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A 3/4 " iron pipe in an existing monument box in asphalt pavement currently occupies this corner. The following witness ties were used to recover and verify its position:
 1 tie from L.C.R.C. L7580 P812

Field measurements were made between the following corners:

From	To	Measurement	Method	Notes
I-3	H-3	2647.06	meas.	
		2637.69	rec.	G.L.O. Notes
		2647.54	rec.	Property descs. Oakland Co. Planning
I-3	J-3	2717.88	meas.	
		2689.50	rec.	G.L.O. Notes
I-3	I-4	2640.27	meas.	
		2640.00	rec.	G.L.O. Notes
		2640.30	rec.	Survey L10065 P264

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I placed a 2" diameter brass cap stamped "Oakland County Remonumentation PS #17632" on the existing found pipe in an existing monument box in asphalt pavement.

N.68° W.	84.44'	P.K. nail and O.C.R. tag in N.E. face D.E. pole
N.50° E.	49.50'	P.K. nail and O.C.R. tag in N.W. face traffic pole
S.49° W.	89.47'	P.K. nail and O.C.R. tag in S.E. face D.E. pole
S.26° E.	65.16'	P.K. nail and O.C.R. tag in S.W. face D.E. pole

The selected location is accepted by me and generally accepted by Professional Surveyors as the best available evidence of the position of the original corner.

Signed by [Signature] Date 2-16-95
 Surveyor's Michigan License No. 17632

