SURVEY & REMONUMENT

MAR 0 4 1998

\$ 9.00 KISCELLANEOUS RECORDING

| • | | INTRACTOR INTRA |
|---|------|-----------------|
| ŧ | 2 66 | DEMINENTATION |

| 2 | EC | oak. | | Ai |
|-----|------|------|------|-----|
| , J | L.V. | | !\ 🥜 | Į V |

LAND CORNER RECORDATION CERTIFICATE JUN 97 3:38 P.M.

RECEIPT# 1794 RECORDED - DAKLAND COUNTY

Filing Requirement of Act 74, Mich. P.A. 1970 LYNN D. ALLEN. CLERK/REGISTER OF DEEDS

For corners in

Oakland

Located In:

Troy Twp. Corner Code #

1. Public Land Survey

2. Property Controlling in Section 3. Miscellaneous

Property in Sec.

K-13

Compliance with ACT 345, P.A. 1990


6-5-97 APPROVED ON: OAKLAND COUNTY REMONUMENTATION PEER GROUP COMMITTEE

Register of Deeds Stamp & File Number

| 4. Lot No | Recorded Plat | |
|-------------------|---------------|---|
| 5. Private Claims | | _ |

Huston R. Kennedy in a field survey on 5/14 , 19 97 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

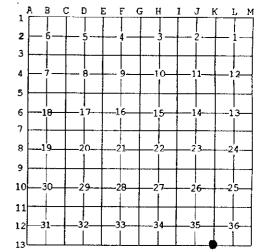

A Description of original monument and accessories and/or subsequent restoration:

1817-GLO Wampler, D.S.; Set Post 8" Elm S60°W 27 Links; 9" Sugar N11 1/2°W 10 Links

1.) 1977-McMahon, PS #4018; LCRC L.7070, Pg.134 - Fnd Handhole

2.) 1993-Higgins, PS #21570; LCRC L.13474, Pg.151 - Fnd 1" Bar in a Monument Box

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1997 Kennedy Surveying, Inc. - Kennedy, PS #17623 - Fnd 1" Iron Rod in a Monument Box in the intersection of John R. Road extendiong to the North & South, which has a concrete surface, Big Beaver Road extending to the East & West, which has a concrete/bituminous surface.

Witnesses from LCRC #1 & 2 were used to recover and verify the location of the found 1" Iron Rod in a Monument Box.

I accepted the found 1" Iron Rod in a Monument Box as the best evidence of the original corner position.

Field measurements between see back side of LCRC

MINISTER S OF MICHIC

HUSTON

יחדואו

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-13 I replaced the found 1" Iron Rod with a 5/8" x 24" Iron Rod w/2" diameter brass cap stamped Oakland County Remonumentation, PS #17623 in an existing Monument Box

S49°E 89.91' Set PK & Remon Washer NE face Power Pole

S46°W 90.58' Set PK & Remon Washer NW face Power Pole

N39°E 161.42' Set PK & Remon Washer NW face Power Pole

N40°W 141.25' SE corner of the East leg of sign for the Oakland Mall

The selected location is accepted by me and is generally accepted by Professional Surveyors as the position of the original corner.

Signed by Surveyor's Michigan License No

6-6-97 Date

SURVEY & REMONUMENTATION

LIBER 17325 M 334

MAR 0 4 1998

SECTION

FIELD MEASUREMENTS BETWEEN

K-13 to J-13

GLO = 40 chains or 2640.00 Ft. Sidwell = 2657.27 Ft. GPS-MEA = 2657.34 Ft.

K-13 to K-12

GLO = 40 chains or 2640.00 Ft. MCS, date not stated = 2640.66 Ft. GPS-MEA = 2640.00 Ft.

K-13 to L-13

GLO = 40 chains or 2640.00 Ft.
MCS = 2668.96 Ft.
"ROBBINS EXECUTIVE PARK EAST NO. 5" + "ROBBINS EXECUTIVE PARK EAST" + Parcels = 2669.42 Ft.
GPS-MEA = 2669.40 F.