

MAY 24 2000

SECTION

LIBER 20329 PG 649

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>Oakland</u> (County)	Located in: Highland Township	Corner Code #
1. Public Land Survey	T3N R7E	H-3
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

273082  
 LIBER 20329 PAGE 649  
 \$9.00 MISC RECORDING  
 \$2.00 REMONUMENTATION  
 07/29/1999 11:46:46 A.M. RECEIPT# 58917  
 PAID RECORDED - OAKLAND COUNTY  
 G. WILLIAM CADDELL, CLERK/REGISTER OF DEEDS


Compliance with  
 ACT 345, P.A. 1990

APPROVED ON: 6-6-99 JK  
 OAKLAND COUNTY REMONUMENTATION  
 PFR GROUP COMMITTEE

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_ Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

I, Huston K. Kennedy, in a field survey on March 1, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

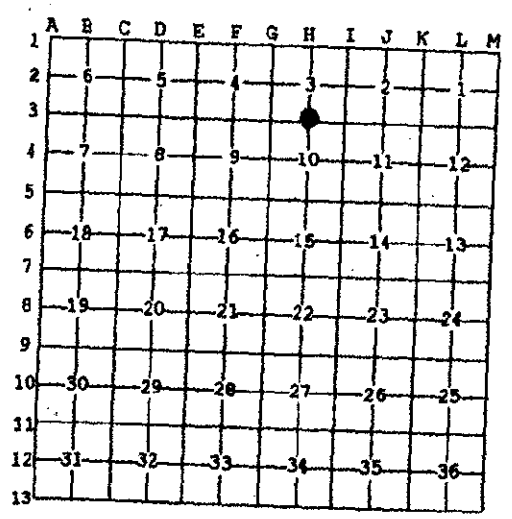

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:  
1815-1816 GLO Wampler, D.S.; No post was set, no witnesses corner fall in a pond
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
1999-Kennedy Surveying, Inc. - Kennedy, PS #17623 - The corner was not set during the original government survey, the corner falls in a pond. The existing monumentation as found in "BRETTON OAKS SUBDIVISION NO. 1" was used to recover this corner. I set two (2) meander corners, Corner #1 is on the North line of Section 10, 209.73 feet East of H-3, and Corner #2 is on the North-South 1/4 line of Section 10, 634.32 feet South of the H-3.

FIELD MEASUREMENTS BETWEEN

H-3 to G-3  
 GLO = 39.90 chains or 2633.40 Ft., (H-3 falls in a pond)  
 No sidwell or plat distances  
 2610.07 Ft. (GPS-CAL)

H-3 to I-3  
 GLO = 39.90 chains or 2673.40 Ft. (H-3 falls in a pond)  
 Sidwell South part E 1/2 of E 1/2 Sec 3 (11-3S) = 2579.46 Ft.  
 2597.45 Ft. (GPS-CAL)

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
H-3 I set a 4" diameter Concrete Monument w/1/2" Iron Rod 36" long w/2" diameter brass cap stamped Oakland County Remonumentation, PS #17623 on the North line of Section 10.

Corner #1  
 N69°E 24.20' Set Mag Nail & Remon Washer North face 24" Oak  
 S67°E 17.90' Set Mag Nail & Remon Washer NE face 6" Poplar  
 S21°E 24.60' Set Mag Nail & Remon Washer West face 7" Poplar  
 S33°E 28.65' Set Mag Nail & Remon Washer SW face 7" Cherry  
 West 209.73 Ft. H-3

(See back side LCRC for Map)

I set a 4" diameter Concrete Monument w/1/2" Iron Rod 36" long w/2" diameter brass cap stamped Oakland County Remonumentation, PS #17623 on the North-South 1/4 line of Section 10

Corner #2  
 N03°E 50.30' Cut "x" on top bolt of Fire Hydrant  
 N49°E 83.35' Set Mag Nail & Remon Washer East face 9" Oak  
 Due South 97.20' Set Mag Nail & Remon Washer West face 26" Oak  
 N87°W 113.60' Set Mag Nail & Remon Washer South face Power Pole  
 North 634.32 Ft. H-3



The selected location is accepted by me and is generally accepted by Professional Surveyors as the best available evidence of the position of the original corner.

Signed by: Huston K. Kennedy

Date 6-1-99

Surveyor's Michigan License No. 17623