

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

OK - T. SMITH

For corners in

Oakland

(County)

Located In: Oxford Twp.

Corner Code ##

- 1. Public Land Survey T 5N R 10E A-4
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R

\$ 7.00 MISCELLANEOUS RECORDING
\$ 2.00 REMONUMENTATION
15 NOV 94 8:56 A.M. RECEIPT# 138
PAID RECORDED - OAKLAND COUNTY
LYNN D. ALLEN, CLERK/REGISTER OF DEEDS
Compliance with ACT 345, P.A. 1990

APPROVED ON: 8-31-94
OAKLAND COUNTY REMONUMENTATION
PEER GROUP COMMITTEE

Register of Deeds Stamp & File Number

- 4. Lot No. , Recorded Plat
5. Private Claims

Grid table with columns A-L and rows 2-13. Cell (4,7) contains a black dot.

I, Huston K. Kennedy, in a field survey on August 10, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1818-GLO Wampler, D.S.; Set Post; 11" Aspen N11\*W 26 Links; 8" Aspen S84\*E 39 Links
1.) 1979-Kennedy, P.S. #17623; LCRC 7417, Pg.487 - Set Spike from adjacent property descriptions
2.) 1978-Kennedy, P.S. #17623; Unrecorded Survey - Set Spike
3.) 1979-Kennedy, P.S. #17623; Unrecorded Survey - Fnd Spike

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1994 Kennedy Surveying, Inc. - Kennedy, P.S. #17623 - Fnd Spike that is located 4.20' West of the centerline of Baldwin Road which is bituminous surface and 4' North of the centerline of Shipman Road, which is a gravel surface extending to the East. A tree-fence line extending to the West.


Witnesses from LCRC #1 were used to recover and verify the location of the found Spike.

I accepted the found Spike as the best evidence of the original corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- A-4 I replaced the found Spike with a 5/8" x 24" Iron Rod w/2" diameter brass cap stamped Oakland County Remonumentation, PS #1762: in a new Monument Box.
N52°E 61.46' Set PK & Remon. Washer NW face Guide Pole
N46°W 48.89' Set PK & Remon. Washer SW face 14" Elm
S63°W 48.44' Set PK & Remon. Washer NW face 13" Elm
S87°E 110.71' Set PK & Remon. Washer North face twin 22" Elm

The selected location is accepted by me and is generally accepted by Professional Surveyors as the best position of the original corner.

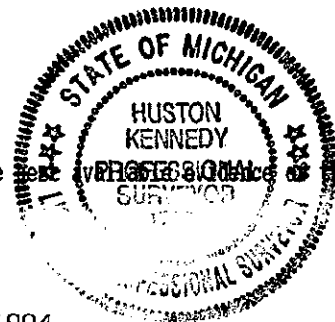

Signed by [Signature]

Date October 14, 1994

Surveyor's Michigan License No. 17623