

SURVEY & REMONUMENTATION

FEB 29 50 1998

OK - T. SMITH

MAY - 1 1995

LIBER 15234 pg 537

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

\$ 7.00 MISCELLANEOUS RECORDING
\$ 2.00 REMONUMENTATION

For corners in

COMMISSION

	Oakland (County)	Located in:	Addison Township	Corner Code #
1. Public Land Survey		T <u>5N</u>	R <u>11E</u>	<u>J-7</u>
		T _____	R _____	_____
		T _____	R _____	_____
		T _____	R _____	_____
2. Property Controlling in Section	S _____	T _____	R _____	_____
	S _____	T _____	R _____	_____
3. Miscellaneous Property in Sec.	S _____	T _____	R _____	_____
	S _____	T _____	R _____	_____

2 FEB 95 7:23 A.M. RECEIPT# 28
PAID RECORDED - OAKLAND COUNTY
LYNN D. ALLEN, CLERK/REGISTER OF DEEDS

Compliance with
ACT 345, P.A. 1990

APPROVED ON: 11-30-94
OAKLAND COUNTY REMONUMENTATION
PEER GROUP COMMITTEE
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Randy Kolehouse, in a field survey on July 21 19 94, do hereby certify that under requirements of P.A. 74 Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

J-7 Per G.L.O. notes, J. Wampler set a post in 1817.

O.C.R.C. Wlts. Iron Pipe	L.C.R.C. L. 6146 P. 503 1973 5/8" Iron Bar	Cert. Survey L. 8124 P. 748 1981 3/4" Iron	L.C.R.C. L 14481 P. 621 1993 5/8" Iron Rod
SE Cor. Barn NW 149.2'	North 58.77' Spike in P. Pole	S 70° W 91.58' P. Pole	N 70° E 49.85' PK/W NW Side 14" Cherry
24' Elm SW 129.3'	SW 91.42' Spike in P. Pole	S 40° E 62.50' 3" Elm	N 58.61' N/W E Side P. Pole
In C/L Roads M/L	SE 64.03' Spike in 24" Stump	North 58.75' P. Pole	S 70° W 90.60' N/W N Side P. Pole S 50° E 62.43' PK/W N Side 13" Elm

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-7 Found 5/8" iron bar 4' North of the C/L of Frick Road (gravel) running E-W on the C/L Texter Road (gravel) running South and checked the following witnesses.

L.C.R.C. L. 6146 P. 503 1973 North 58.77' Spike in P. Pole SW 91.42' Spike in P. Pole	Cert. Survey L. 8124 P. 748 1981 S 70° W 91.58' P. Pole North 58.75' P. Pole	L.C.R.C. L. 14481 P. 621 N 70° E 49.85' PK/W NW Side 14" Cherry N 58.61' N/W E Side P. Pole S 70° W 90.60' N/W N Side P. Pole S 50° E 62.43' PK/W N Side 13" Elm
---	--	--


Daly Measures West 2679.38' to I-7
Kobs Measures South 2642.53' to J-8
King Measures East 3040.64 to K-7

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-7 Set a 5/8" rebar with brass cap stamped "Oakland County Remonumentation P.S. #25854" in place of found 5/8" iron rod.

PK Nail & Tag Stamped "Oakland Co. Remonumentation P.S. #25854" in NW Side 14" Cherry N 70° E 49.85'
PK Nail & Tag Stamped "Oakland Co. Remonumentation P.S. #25854" in E Side P. Pole N 58.61'
PK Nail & Tag Stamped "Oakland Co. Remonumentation P.S. #25854" in N Side P. Pole S 70° W 90.60'
PK Nail & Tag Stamped "Oakland Co. Remonumentation P.S. #25854" in N Side 13" Elm S 50° E 62.43'

The selected location is accepted by the Contractor and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

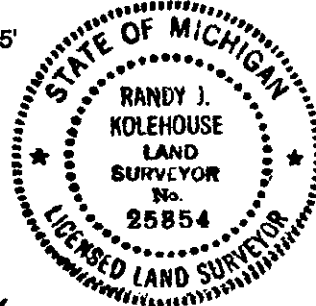

Signed by Randy J. Kolehouse Date 12/23/94
Surveyor's Michigan License No. 25854