

STATE OF MICHIGAN  
 COUNTY OF OCEANA  
 RECEIVED FOR RECORD

LAND CORNER RECORDATION CERTIFICATE  
 Filing Requirement of Act 74, Mich. P.A. 1970

3 DEC 1999 2:05:42 PM

For corners in SECTION

Oceana (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>13NR 15W</u>	<u>E-9</u>
	T <u>  R</u>	<u>  </u>
	T <u>  R</u>	<u>  </u>
	T <u>  R</u>	<u>  </u>
2. Property Controlling in Section	S <u>  T</u>	<u>  R</u>
	S <u>  T</u>	<u>  R</u>
3. Miscellaneous Property in Sec.	S <u>  T</u>	<u>  R</u>
	S <u>  T</u>	<u>  R</u>

JOSEPH E. MERTEN  
 REGISTER OF DEEDS


100925

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, J. Randolph Hepworth in a field survey on August 12, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

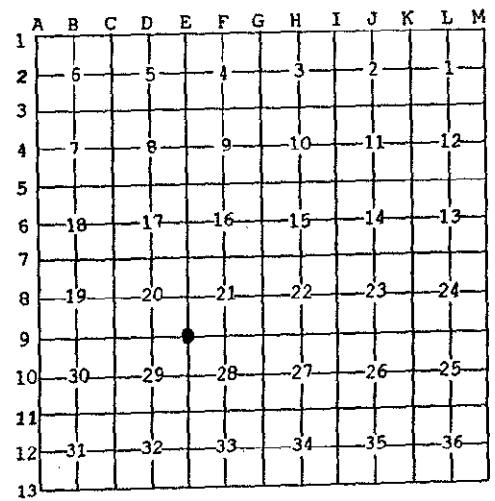

A. Description of original monument and accessories and/or subsequent restoration:

E-9 CORNER COMMON TO SECTIONS 20, 21, 28 & 29 T13N, R15W GREENWOOD TOWNSHIP  
 GLO J. Mullett 1838 SET POST fr which 10" Y. Pine S49°E (10lks) 6.6' 12" B. Oak N69°W (20lks) 13.2'  
 OGRC WITNESS BOOK 1987 1" Sq. Cast Iron 10" long at N. edge of E & W Rd in line with fence North  
 Spike in oak S5°E 34.23' Spike in fence post N4°E 22.65'  
 USFS Witness Card, John Bueche #13027, 1987, Fd 1" Sq Iron  
 Wire Fence North 23' On N. Edge of E-W 2-track

Oceana County Remonumentation  
 Peer Group Reviewed & Approved  
 Date: 10-27-99  
JRH  
 J. Randolph Hepworth  
 Oceana County Surveyor

- 1) PK Nail in 13" B. Oak S5E 34.23'
  - 2) PK Nail in 12" Oak N5W 25.01'
  - 3) PK Nail in 16" Oak N60W 58.10'
  - 4) PK Nail in 10" Oak S30W 37.80'
- LCRC # 100363, John Bueche #13027, 10/21/87, Fd 1" sq Iron  
 1" Sq. Cast Iron 10" long at N. edge of E & W Rd in line with fence North
- 1) PK Nail in W side 18" B. Oak S5°E 34.23'
  - 2) PK Nail in E side 12" Oak N5°W 25.01'
  - 3) PK Nail in NE side 16" Oak N60°W 58.10'
  - 4) PK Nail in NW side 10" Oak S30°W 37.80'

Unrecorded Survey, JR Hepworth #26457, 10/5/89 Fd 1" sq Iron RAG Witnesses

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

I found a 1" sq cast iron piece about 10" long and is odd-shaped at the north edge of E-W dirt road and on old fence to the north. All Bueche 1987 witnesses are standing and measure OK, except witness #2 & #3 are now recent stumps. No other documentation is known to me regarding the history of this corner.

I accept the cast iron as the best available evidence of the position of the original corner. No evidence is known to me that would lead me to believe the corner should be at another location.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 4"x20" Harrison Cast Iron Monument, stamped "County Surveyor" and "26457" at the position of the iron which was broken up and placed in the bottom of the hole below the monument.

60d spk	SE Face	24" W Oak	69°az	107.10'	EDM
60d spk	SW Face	Power Pole	301°az	35.19'	EDM
60d spk	W Face	12" W Oak	206°az	37.75'	EDM
60d spk	W Face	30" Oak	167°az	34.09'	EDM

Signed by J. Randolph Hepworth  
 Surveyor's Michigan License No. 26457

Date November 30, 1999

