LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970


STATE OF MICHIGAN COUNTY OF OCEANA RECEIVED FOR RECORD

-	pro	1000	n. 18.78	Bu
J	UCU	1777	2:12:39	ΥП

		1 MWA 1111 M-WE-A1 111
Oceana (County)	Located In: Corner Code #	JOSEPH E. NERTEN REGISTER OF DEEDS
1. Public Land Survey	T_15NR_18W	100943
Property Controlling in Section Miscellaneous Property in Sec.	S TR	·
ì		Register of Deeds Stamp & File Number
4. Lot No, Reco	rded Plat	

Randolph Hepworthin a field survey on October 1,319 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

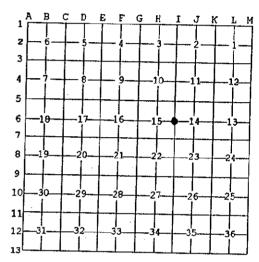

Oceana County Remonumentation

Peer Group Reviewed & Approved

11-11-99

124

J. Randolph Hepworth

Oceana County Surveyor

A. Description of original monument and accessories and/or subsequent restoration:

I-6 1/4 CORNER COMMON TO SECTIONS 14 AND 15 T15N, R18W

GOLDEN TOWNSHIP

J. Mullett 1838 SET POST 12" Beech S48°W (50 lks) 33.0' 12" Hemlock S15°E (25 lks) 16.5'

Book A, Pg.198, EM Hyde, 1888; " A stone fr wh -a stone bears S48.5°W 46 lks & a stone bears N45°E 79 lks "

LCRC #100256, K. Ross #17634, 1/21/77, Set R/R Spike Cen. Rd E-W,S

1) 30" Tw. Willow 2) 12" Maple

N60°W

3) PP

5. Private Claims

\$30°E S50°W

51.17 85.09

Unrecorded Survey, JR Hepworth #26457, 5/12/93 Fd R/R Spike

16" Maple

70.54

3) P pole 156°az 246°az 85 12

Rd name sign

228°az 13.22

72°az

5) T pole

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

Spike in the centerline intersection of Roads E-W & S. Occupation line to North begins about 700'± North. Corner fits Ross witness of LCRC Two Ross witnesses remain and measure OK. Corner falls in road fill section in excess of 10' above original soil grade. I have no history of No. 100256. this corner between 1888 and 1977. I did not believe any excavation to attempt to locate the Hyde 1888 stone would be beneficial, economical or

I accept the RR Spike as the best evidence of the position of the original corner. No evidence is known to me that would lead me to believe the corner should be at another location.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 4"x20" Harrison Cast Iron Monument, stamped "County Surveyor" and "26457" 2) 3) 60d spk 18" Maple Power Pole **NE Face** 152°az 70.94 **EDM** RR spk S Face 246°az 84.95 **EDM** 60d spk N Face Tele Pole Stump 68°az 87.28 **EDM** 60d spk SW Face 36" Maple 310°az 138.24 EDM

Surveyor's Michigan License No. 26457 November

