

SURVEY & REMONUMENTATION

APR 29 1996

COMMISSION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Ogemaw
(County)

Located In:

Corner Code #

1. Public Land Survey

T 21NR 1E M-5

T ___ R ___

T ___ R ___

T ___ R ___

2. Property Controlling
In Section

S ___ T ___ R ___

3. Miscellaneous
Property In Sec.

S ___ T ___ R ___

S ___ T ___ R ___

LIBER

3 PAGE 20

STATE OF MICHIGAN
OGEMAW COUNTY
RECORDED

28 DEC 95 3:19 P.M.

WANDA HUZIK
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

Timothy L. Lapham, in a field survey on December, 1995 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

M-5: GLO Clason 1838, Set Post, 12" Hemlock N40W 15 lns, 12" Hemlock S35W 15 lns;
Unrecorded Survey, Henning, 1942, No Cor Mat, No Wits, Dist to MC South 2137.7';
Unrecorded Survey, Richardson, No Date, No Mat, No Wits, Dist to MC South 2137.7';
Plat, Richardson, Springhill Subdivision No. 2 (Rec 3-48, 8/11/60), No cor mat, No wits;
Survey McGinnis 5/7/74(Rec 1-399-400, 6/12/74), No Cor Mat, No Wits;
Survey Higgins 6/15/81(Rec 3-291, 6/16/81), Set 1/2" Steel Bar, No Wits;
Survey(revised) Higgins 10/12/83(Rec 3-432, 10/12/83), No Cor Mat, No Wits;
Unrecorded survey, Lapham, 10/25/95, Found 1/2" Iron, 4 Wits;

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-5: No evidence of GLO Survey Found. Found 1/2" iron in accord with ALL above recorded and unrecorded surveys. Accepted found iron as best evidence of the accepted position of corner. See dossier for additional information.


**APPROVED BY
PEER REVIEW**

12/20/95 *JLL*

DATE P.A. 345 of 1990

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-5: set 5/8"x36" rerod with 3-1/4" Aluminum Ogemaw Remon cap marked "27595 1995"
From Which:
N36E 61.42' 10" Triple Cedar with nail
S30E 57.30' 10" Maple with nail
S57W 97.31' N.E. Corner of House
N68W 37.66' Utility Pole with nail

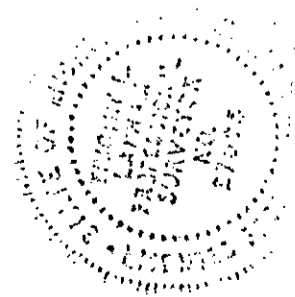

Signed by *Timothy L. Lapham*
Surveyor's Michigan License No. 27595

Date 12/28/95