

**SURVEY & REMONUMENTATION**

APR 29 1996

COMMISSION

**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ogemaw (County)	Located In:	Corner Code #
1. Public Land Survey	T 24NR 2E	B-13
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

LIBER 3 PAGE 38

STATE OF MICHIGAN  
OGEMAW COUNTY  
RECORDED

28 DEC 95 3:23 P.M.

WANDA MUZIK  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

Timothy L. Lapham, in a field survey on December, 19 95 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5										
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

B-13: GLO Clason 1838, Set Post, 22" Y. Pine N41E 64 lns, 16" Y. Pine N42W 79 lns;  
LCRC Cavanagh 9/6/72(Rec 1-11-12, 9/28/72), Found 1/2" Bar, 3 Wits;  
Survey Ledy 5/15/85(Rec 3-543-4, 7/12/85), Found 1/2" Bar, Record Wits;  
LCRC Lapham 2/2/89(Rec 2-38, 3/22/89), Set 3/4" capped Pipe by SPM, 6 Wits;  
LCRC Lapham 1/20/89(Rec 2-43, 3/22/89), Found 1/2" Iron, 5 Wits;  
Unrecorded 1956 & 1966 survey by Henning, corner not marked distances shown;  
unrecorded 1967 road plans by Richardson, 1-1/4" pipe, 4 wits;  
unrecorded 1980 survey by K. Ostling, 1/2" bar, no wits;


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

B-13: No evidence of GLO found. Found 5/8" capped iron in accord with all other surveys and LCRCs except LCRC 2-43 is for corner B-1 23N2E and unable to verify that 1967 road plans match this corner. Accepted found corner as best available evidence of corner position. See dossier for additional information.

APPROVED BY  
PEER REVIEW  
12/11/95  
DATE R.A. 345 of 1990

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

B-13: SET 5/8"x36" REROD WITH 3-1/4" ALUMINUM REMON CAP  
WEST 14.53 CLOSING CORNER MONUMENT  
S30E 47.01 6" JACK PINE WITH SPIKE  
S01E 44.63 10" JACK PINE WITH SPIKE AND 2 FACE BLAZES  
S23W 36.62 DNR POST WITH SPIKE  
S39W 54.40 10" JACK PINE WITH SPIKE AND 2 FACE BLAZES  
N28W 45.74 10" JACK PINE WITH SPIKE  
N34E 64.39 12" JACK PINE WITH SPIKE

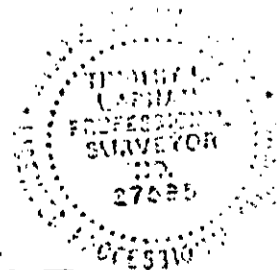

Signed by [Signature]  
Surveyor's Michigan License No. 27595

Date 12/28/95