

MAR 02 2001

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in

Ontonagon County	Located in:	Corner Code #
1. Public Land Survey	T48N R41W T48N R42W T R T R T R	A - 10 M - 10
2. Property Controlling in Section	S T R S T R	
3. Miscellaneous Property in Sec.	S T R S T R	
4. Lot No.	Recorded Plat	
5. Private Claims		

JUDITH D. ROEHH
Ontonagon County
Page 1 of 1
JEM Date 12/08/2000
RECORDING FEE:

1P
LC 5/355
Time 11:42:45
9.00

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Joseph C. Domitrovich, in a field survey on November 3, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(A - 10/M - 10) 1/4 Corner Common to Sections 30, T48N, R41W & Section 25, T48N, R42W.

1847 - William A. Burt, 8" Cedar for Corner:

8" Cedar S 10°E 10 links

I found no record of Subsequent restoration.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of original corner or accessories. I found a 1" O.D. iron pipe at the 1/4 corner position. Distances to Section Corners North and South work very well with GLO. I have accepted the iron pipe as the best representation of the original 1/4 corner and have Monumented it as such.


Research on file with County Remonumentation Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 3/4" x 48" aluminum rod with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T48N, R42W, R41W, S. 25, S. 30; 1/4; 2000; P.S. 37273. The aluminum rod is driven inside the found 1" O.D. iron pipe. Ties:

4" Soft Maple	S 51°W	8.17'
6" Soft Maple	N 75°W	10.60'
4" Hard Maple	N 13°E	9.26'
12" Ash	S 60°E	4.31'
Steel Sign Rail	South	0.54'
SW Cor. Sec. 30	S 00°00'51"W	2629.66'
NW Cor. Sec. 30	N 00°06'46"W	2627.20'

Joseph C. Domitrovich
COUNTY REMONUMENTATION
11-29-00

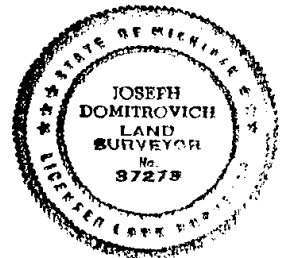

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted. Bearings shown between corners are on assumed basis, for reference only.

Signed by *J. C. Domitrovich*

Date 11/28/00

Surveyor's Michigan License No. 37273