RECORDING FEE:

## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 1 1 10/2000

Ontonagon County

LC 5/307 Time 12:13:33

9.00

For corners in

Ontonagon County	Located in:			Corner Code #
1. Public Land Survey		T51N T T T	R39W R R R	I - 1
2. Property Controlling	S	T	R	
in Section	S	1	R	
Miscellaneous	S	T	R	
Property in Sec.	S	T	R	

SURVEY & EMONUMENTATION

MAR 02 2001

SECTION


Register of Deeds Stamp & File Number

4. Lot No.

, Recorded Plat Private Claims

I, Joseph C. Domitrovich, in a field survey on June 20, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

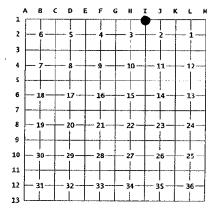

A. Description of original monument and accessories and/or subsequent restoration: (I - 1) Closing Comer for Sections 3 & 2, T51N, R39W. \* Note: Corner not

common with Section to North.

September 1845 - Austin Burt intersected the township line 92 links (60.72') east of the SE corner of Section 34, T52N, R39W, and set a post. Ties to this post were:

10" Hemlock

S 11°W

29 links (19.14')

8" Fir

S 62°F

42 links

1923 - E.J. Donnelly, Reg. C.E., found this corner and 2 scribed B.T.s (see writing in original notes at Ontonagon County Register of Deeds.)

1.3' dia. Hemlock

S 10°W

19'

20"+ Maple

N 45°W

72'

At first he believed this was the SE corner of Section 34, T52N, R39W, but later he noted that the Hemlock he found was a B.T. for this corner. Also in the notes, in faint pencil, are dimensions west to a stream crossing and to SW corner Section 34, T52N, R39W. He does not indicate what he found marking this corner.

B. Description of comer evidence found and/or method applied in restoring or reestablishing comer: I found no remains of the original Bearing trees. Comer now falls at the northerly edge of a power line clearing and at the southerly edge of a clear-cut. I found a bent 5/8" square topped iron pin 30" long. It is the same type of pin used by Donnelly to mark other corners in this township. (He calls this a lightening rod) The SW corner of Section 34, T52N, R39W to the west had been monumented with the same type of rod. I believe this to be the same corner called for by Donnelly. I have accepted it as the closing corner.

Research on file with County Remonumentation Representative.

C. Description of monument for comer and accessories established to perpetuate locating the position of the corner: Corner is a 3/4" x 48" aluminum rod with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T51N, R39W; S. 3, S. 2; C.C.; 2000; P.S. 37273. Ties:

Steel Sign Rail	North	0.61' PEER GROUP APPROVED
5" Balsam	East	25.41'
Northerly Power Pole	S 06°W	38.67' Car a apple camp
Standard Corner	S 89°32'54"W	60.72' COURTE DEFENDATION 6-21-00
6" Balsam	N 36°W	39.33'
SW Cor. Sec. 34, T52N R39W	S 89°54'06"W	5347.25' (5347.2' Donnelly) (5340.72' GLO calc.)
N 1/4 Cor. Sec. 3	S 89°53'51"W	2660.42'
N 1/4 Cor. Sec. 2	N 89°33'13"E	2604.55'
SW Cor. Sec. 2	S 00°14'19"E	5249.26' (5260.2 GLO)

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

4/21/00 Date

DOMITROVICH LAND SURVEYOR

**IOSEPH** 

Surveyor's Michigan License No. 37273

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSION