

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ontonagon
 (County)

Located In: _____ Corner Code # _____

- | | | |
|------------------------------------|-------------------------|-------|
| 1. Public Land Survey | T 52N R 37W | K10 |
| | T 52N R 37W | K11 |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

K11 Jun 04 2001
 K10 May 31 2001

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

| | | | | | | | | | | | | | |
|----|----|---|----|---|----|---|----|---|----|---|----|---|---|
| | A | B | C | D | E | F | G | H | I | J | K | L | M |
| 1 | | | | | | | | | | | | | |
| 2 | 6 | | 5 | | 4 | | 3 | | 2 | | 1 | | |
| 3 | | | | | | | | | | | | | |
| 4 | 7 | | 8 | | 9 | | 10 | | 11 | | 12 | | |
| 5 | | | | | | | | | | | | | |
| 6 | 18 | | 17 | | 16 | | 15 | | 14 | | 13 | | |
| 7 | | | | | | | | | | | | | |
| 8 | 19 | | 20 | | 21 | | 22 | | 23 | | 24 | | |
| 9 | | | | | | | | | | | | | |
| 10 | 30 | | 29 | | 28 | | 27 | | 26 | ● | 25 | | |
| 11 | | | | | | | | | | ● | | | |
| 12 | 31 | | 32 | | 33 | | 34 | | 35 | | 36 | | |
| 13 | | | | | | | | | | | | | |

A. Description of original monument and accessories and/or subsequent restoration:


- (K10) Quarter corner common to Sections 25 & 26. 1846: Established by S.W. Higgins. ...40.00 Set 1/4 Sect. post. Sugar 10 N40E 22, Sugar 13 S30W 26.
 (K11) Corner common to Sections 25-26-35-36. 1846: Established by S.W. Higgins. North 80.00 Set post cor Sec. 25-26-35-36. Sugar 16 S5W 54, Sugar 12 N35E 20.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (K10) The original post and accessories were not recovered. Reestablished the corner on a line of mean true bearing (N 04 deg. 09' 21" E) between Section corners 2494.28 feet north and south, being proportionate to the original record.
 (K11) Original post and accessories were not recovered. Found a 1" ID iron pipe, set firmly, projecting 3.8 feet, and 6 trees with old blazes facing it. Also found two locations posters facing the pipe. Recovered iron pipes at section corners S 0 deg. 26' E 5374.6', N 04 deg. 09' E 4988.6', and S 88 deg. 43' E, 5306.4' (true bearings). In spite of the fact that these measurements differ with the original record; I accept the pipe as the best available evidence of the position of the original corner, ascribing the variation to erroneous work on the part of the deputy surveyor.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- | | |
|---|--|
| (K10) Set 1" IDx32" iron pipe with 4 alum. MDNR tablet. Blazed and scribed: | (K11) Found 1" ID iron pipe. Blazed and scribed: |
| 17" Sugar S82E 12.5' "1/4S NBT" | 16" Sugar N87E 24.2' * "S25 NBT" |
| 6" Sugar S12E 26.6' do | 8" Y. Birch S29E 23.8' "S36 NBT" |
| 12" Sugar N83W 37.4' do | 8" Sugar S26W 43.2' "S35 NBT" |
| 10" Y. Birch N41W 41.0' do | 20" Sugar N71W 11.5' * "S26 NBT" |
| Set sq'd ironwood post adjacent. | Bearings are magnetic. Distances to notch in lower blaze. *this tree had old blazes. |
| Bearings are magnetic. Distances are to notch in lower blaze. | |

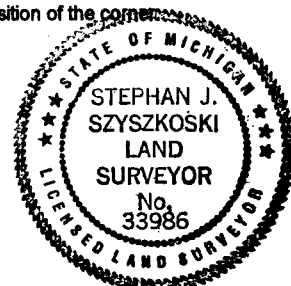

Signed by Stephan J. Szyszkoski Date 9/25/01
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Office of Property Management