

JUDITH D. ROEHM
LAND CORNER RECORDATION CERTIFICATE Ontonagon County
 Filing Requirement of Act 74, Mich. P.A. 1970 of 1

1P
 LC 5/319
 JEM Date 07/10/2000 Time 12:13:39
 RECORDING FEE: 9.00

For corners in

Ontonagon County Located in: Corner Code #

1. Public Land Survey T52N R39W L - 13
 T R
 T R
 T R

2. Property Controlling S T R
 in Section S T R

3. Miscellaneous S T R
 Property in Sec. S T R

4. Lot No. , Recorded Plat

5. Private Claims

**SURVEY &
 REMONUMENTATION**

MAR 02 2001

SECTION

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	N
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Joseph C. Domitrovich, in a field survey on June 14, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(L - 13) South ¼ Corner Section 36, T52N, R39W. *Note - Not Common with ¼ Corner to South.

1845 - William A. Burt set an Ironwood Post with ties:

7" Fir N 45°E 14 links
 24" Fir N 05°W 21 links

1956 - Ned Hawley, Timber cruiser, noted in his copy of the original notes that he did not find this corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of original corner or accessories. Corner now falls in low, swampy area at North edge of power line clearing. The area has been heavily logged. I re-established corner position by single proportionate measurement.


Research on file with County Remonumentation Representative.

Earl W. Applekamp
 COUNTY REMONUMENTATION 6-21-00

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 2 ½" x 30" diameter aluminum pipe with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; T52N, R39W, S. 36, ¼, S. C.; 2000; P.S. 37273. Ties:

Southerly Power Pole #265	S 55°E	88.69'
7" Balsam	N 38°W	31.11'
8" Poplar	N 66°E	60.28'
Steel Sign Rail	North	0.48' (to face)
N ¼ Cor. Sec. 1, T51N, R39W	N 89°52'50"E	3.96'
SW Cor. Sec. 36	S 89°52'50"W	2657.13'
SE Cor. Sec. 36	N 89°52'50"W	2657.13'

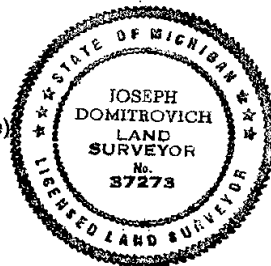

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by Joseph C. Domitrovich

Date 6/21/00

Surveyor's Michigan License No. 37273