

**SURVEY &
REMONUMENTATION**

DEC 13 2000

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

SECTION

For corners in <u>Osceola</u>	Located in:	Corner Code#
1. Public Land Survey	T 18 N R 9 W	D-11
	T R	
	T R	
	T R	
2. Property Controlling S in Section	T R	
	S T R	
3. Miscellaneous S Property in Sec.	T R	
	S T R	
4. Lot No. _____ Recorded Plat _____		
5. Private Claims _____		

OSCEOLA COUNTY
REGISTER OF DEEDS
00 OCT 11 AM 9:49
Robert L. Wetherell

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert L. Wetherell, in a field survey on May 8, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

D-11 - 1/4 Corner common to Sections 29 & 32, T18N, R9W

A. Description of original monument and accessories and/or subsequent restoration:

1838 - J. Hodgson, G.L.O.

- #1 - 8" Hemlock N32°W 26 Links
- #2 - 9" Hemlock S73°E 11 Links

Undated - Co. Sur Twp. Notes

- Page 6
- #3 - Cherry S.E. 39.6'
- #4 - Maple N10°E 33.2'

1981 - R.L. Wetherell, LS 24624

- L.C.R.C. - Liber 02, Pg. 172
- Survey recorded Liber 388, Pg. 828
- "Found Iron Stake and both witnesses from Township notes".
- #3 - 12" Cherry Clump S74°E 39.70'
- #5 - 10" Oak N16°W 19.55'
- #6 - 6" Oak S4°E 20.48'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found a 1" x 24" Iron Rod next to a wood fence post. Corner is 30 feet more or less South of two-track road. I measured 2633.02 feet East to Section corner and 2637.66 feet West to Section corner.

Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Found in good condition, #4 Gone, #5 Found in good condition, #6 Found in good condition.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced the 1" rod with 1" x 18" pipe with Osceola County Remon Cap, and is accepted as a careful and faithful reestablishment of the position of the original corner.

- 10" R. Oak S3°E 20.26' (60d spike E. side) #6
- 14" Ash S83°E 44.96' (60d spike S. side)
- 16" R. Oak N19°W 19.56' (60d spike W. side) #5
- 4" R. Oak N54°W 38.54' (center)

APPROVED LAND CORNER
P.A. 345 OF 1990
Osceola County

R.L.W.
8-17-2000

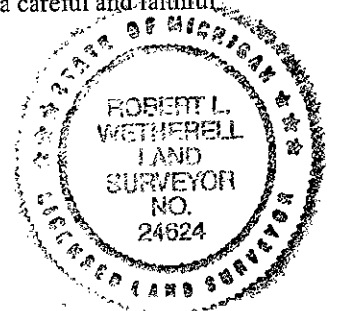

Signed by Robert L. Wetherell
Surveyor's Michigan License No. 24624

Date August 22, 2000

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN 28, 1971
REVISED MAY 14, 1975
REVISED JAN. 1983
ADAPTED FOR WORD PROCESSING JANUARY, 1999