

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>28</u> N. R. <u>1</u> E.	<u>K-10; K-11; L-11</u>
2. PROPERTY CONTROLLING IN SECTION <u>25</u>	T. <u>28</u> N. R. <u>1</u> E.	<u>10</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Kenneth J. Ostling, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on April 14, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and/or subsequent restoration~~

C. (continued)

	10
Set 1 1/2"x2' pipe & red-top post	
5" R. Oak	S18°E 15.7
6" R. Oak	N55°E 36.3
3/4" pipe	N84°W 5.0


B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- K-10 Set by proportionate measurement between section corners. Found a 3/4" pipe about 13.5' northerly of corner but could find no support for it and cannot determine origin.
- K-11 Found 1 1/2" pipe at road intersection possibly Schaaf survey monument. Nothing else evident.
- L-11 Set corner by proportionate measurement, midpoint on line, between section corners. This point faced by old NBT, but could find no monument.
- 10 Set by standard survey procedure. Found 3/4" pipe about 5' westerly which did not fit any existing control and could not accept that location.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-10	K-11	L-11
Set DNR mon. & red-top post	Left 1 1/2" pipe, in place	Set DNR mon. & red-top post
5" R. Oak N14°E 26.2	7" J. Pine N18°E 18.95	6" J. Pine N37°E 45.0
11" R. Oak N78°W 53.6	6" R. Oak N30°W 36.27	8" J. Pine S52°E 65.3
3/4" pipe N07°W 13.49	12" J. Pine S66°E 50.03	8" J. Pine (old NBT) N41°W 20.1

SIGNED BY *Kenneth J. Ostling*
 SURVEYOR'S MICHIGAN REGISTRATION NO. 10068

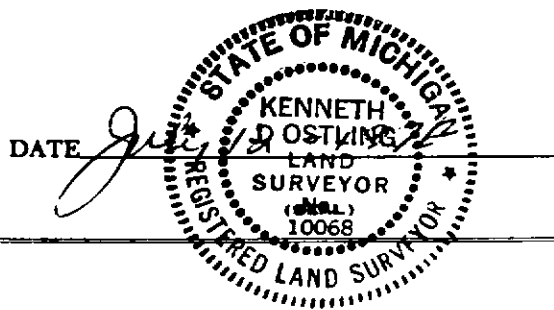

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. _____