

# SURVEY & REMONUMENTATION

APR 24 1995

COMMISSION

OTTAWA COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

94 DEC 14 AM 10:03

*Phyllis Robinson*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI

For corners in

<u>Ottawa</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>5N</u> R <u>16W</u>	<u>K-10 E1/4 Cor.</u>
	T _____ R _____	<u>Sec 26</u>
	T _____ R _____	<u>Park Twp.</u>
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	16	17	18	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, John P. Clapp, in a field survey on November 21, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

<u>K-10</u>	<u>K-10</u>
Govt Land Office Survey Notes	Recorded in Liber 2
1832-Surveyor, Calvin Britain	Page 15, Feb 16, 1973
Set Post	Found "T" Iron
18" Hemlock N45 °E 12 links	Power Pole SSE 30.60'
12" Hemlock S70 °W 20 links	30" Pine SW 57.13'
See reverse side for additional	T Pole NW 37.84'
notes (Liber 4, Page 174)	Iron W 8.59'
	E. Edge Pave W 3'

K-10  
Recorded in Liber 2  
Page 109, April 13, 1973  
Found "T" Iron  
20" Pine SW 57.20'  
Power Pole SSE 31.18'  
30" Oak NW 36.51'  
6" Pine NE 47.31'

3. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K-10  
Found 3/4" steel bar in monument box and accepted it as a careful and faithful perpetuation of the position of the original corner

Found Nail & Tag in W Side Power Pole	AZ 171°	31.17'
Found Scar in SE Side 10" Pine	AZ 55°	47.33' ±
Found Nail & Tag in NNE Side Power Pole	AZ 171°	30.59'
CL Hydrant	AZ 64°	51.99'
Found P.K. in W Side Power Pole	AZ 171°	31.09'
Found Nail in NW Side 24" Pine	AZ 236°	55.73'
Found P.K. SW Side Telephone Pole	AZ 311°	38.25'

*Madison P. Nedewell*

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K-10  
Set O.C. Remon Iron & Cap in Monument Box


O.C. Remon Tag & Nail SE Side 26" Oak	AZ. 60°	67.64'
O.C. Remon Tag & Nail ENE Side 10" Maple	AZ. 159°	44.51'
O.C. Remon Tag & Nail NNW Side 24" Pine	AZ. 236°	55.82'
O.C. Remon Tag & Nail SW Side 24" Beech	AZ. 307°	76.89'

PA. 345 OTTAWA COUNTY

PEER APPROVED 12/12/94

Signed by John P. Clapp  
Surveyor's Michigan License No. 14091

Date Dec 5, 1994

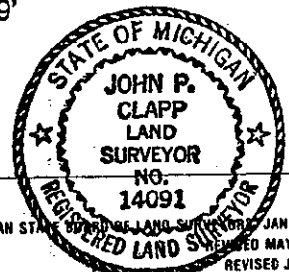

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS JAN. 28, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983

Liber 4, Page 174

<-10 Set 3/4" iron in monument box

- N.E. 52.00' to centerline of top of fire hydrant
- S.E. 31.10' to P.K. nail in west side of power pole
- S.W. 55.78' to nail in north side of 18" Pine
- N.W. 38.30' to P.K. nail in S.W. side of power pole.

120  
 9.00  
 2007  
 1255