

SURVEY & REMONUMENTATION

JUN 28 1999

Ottawa County Remonumentation

RECORDED

98 NOV -4 PM 2: 30

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ottawa (County)	Located In:	Corner Code #
	7N 14W	E-2
1. Public Land Survey	T___ R___	W 1/4, cor. Sec. 4
	T___ R___	Polkton Township
	T___ R___	
	T___ R___	
2. Property Controlling in Section	S___ T___ R___	
	S___ T___ R___	
3. Miscellaneous Property in Sec.	S___ T___ R___	
	S___ T___ R___	

Sam Mullett
REGISTER OF DEEDS
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Maurice J. Rosema Oct. 17 98

I, _____, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5	●	4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	

A. Description of original monument and accessories and/or subsequent restoration:

E-2
GLO - 1837 by Mullett LCRC rec. Liber 5, Page 335
Set post (1988 - Rosema)
9" Hemlock - S39°W 27 links 1/2" iron pipe
10" Sugar - N18°E 20 links Nail in N side 15" Aspen - WSW 36.04'
Nail in E side 30" Oak - S 54.17'
Nail in SE side 6" Ash - SW 4.80'
Nail in NW side 6" Ash - NE 37.05'


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-2
Found 1/2" iron pipe, replaced with 5/8" X 3' steel rod with O.C. remon. cap
Found nail in SE side 6" Ash - SW 4.77'
Found nail in NW side 6" Ash - NE 37.06'
Found nail in N side 18" Aspen - WSW 36.03'
Found nail in E side 36" Oak - S 54.20'
At wire fence corner (fence to S and W)

I hereby accept the C.I. mon. as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-2
5/8" X 3' steel rod with O.C. remon. cap
Set nail and remon. tag in NW side 8" Ash - N15°E 38.91'
Set nail and remon. tag in N side tw. 6" Ash - N90°E 24.30'
Set nail and remon. tag in NW side 6" Ash - N42°E 37.06'
Set nail and remon. tag in SE side 6" Ash - S57°W 4.77'
Set nail and remon. tag in N side 18" Aspen - S85°W 36.03'
Set nail and remon. tag in E side 36" Oak - S0°E 54.20'
At fence corner (fence to S and W)

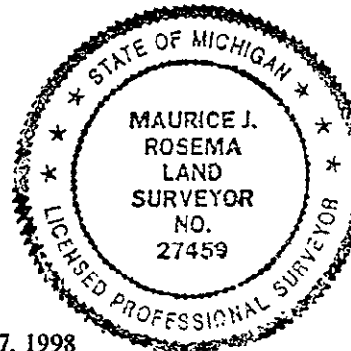

\$9.00 CORNER
Receipt #18213
\$1.00 PHOTO
Receipt #18213

10/19/98
YDY

Signed by *Maurice J. Rosema*
Surveyor's Michigan License No. 27459

Date Oct. 17, 1998