

**SURVEY &  
REMONUMENTATION**

AUG 20 1996

**COMMISSION**

Ottawa County remonumentation  
**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

93 DEC 15 AM 9:27

*Elizabeth Robinson*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI

For corners in  
Ottawa

(County)	Located In:	Corner Code #
1. Public Land Survey	T <u>7N</u> R <u>14W</u>	<u>I-12</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	<u>Sec. #1</u>
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Maurice J. Rosema, in a field survey on July 21, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

I-12	Spicer - 1972 per L.C.R.C. recorded in Liber 1, Page 817 3/4" iron 32" Maple - S33°E 49.3' CP pole - N25°W 83.0' 18" Box Elder - N60°E 37.85'	Joiner - 1981 per L.C.R.C. recorded in Liber 4, Page 193 C.I.M. 29" Box Elder - NE 36.97' 10" Pine - West 43.13' 29" Maple - SE 48.92' 31" Maple - SE 71.13'	Rosema - 1984 per L.C.R.C. recorded in Liber 5, Page 162A C.I.M. Nail in W side 30" Maple - S30°E 49.38' Nail in S side 30" Box Elder - N70°E 38.09' Nail in E side P. pole - N15°W 83.18'
------	--	--	---


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-12 Found C.I. monument  
Found nail in W side 30" Box Elder - S30°E 49.38'  
Found nail in S side 38" Box Elder - N70°E 38.04'  
Found nail in E side P. pole - N15°W 83.21'  
Found P.K. nail in N side 15" Pine - N83°W 43.10'

I hereby accept this corner as a correct and accurate perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-12 C.I. monument  
Set nail and O.C. remon. tag in S side 38" Box Elder - N70°E 38.09'  
Set nail and O.C. remon. tag in W side 31" Maple - S19°E 71.13'  
Set nail and O.C. remon. tag in E side P. pole - N15°W 83.21'  
Set nail and O.C. remon. tag in N side 15" Pine - N83°W 43.10'  
Set nail and O.C. remon. tag in W side 30" Box Elder - S30°E 49.38'  
Centerline of N-S gravel road - E 4'

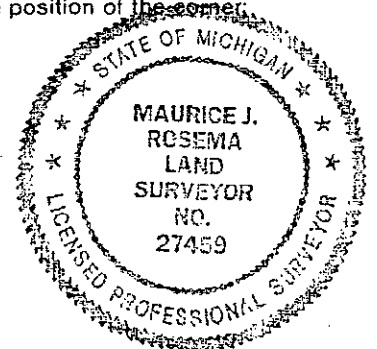

Signed by Maurice J. Rosema  
Maurice J. Rosema - Tru-Line Surveying 27459  
Surveyor's Michigan License No. \_\_\_\_\_

Date October 02, 1993