

SURVEY & REMONUMENTATION

FEB 27 1998

OTTAWA COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

SECTION
For corners in
OTTAWA
(County)

Located in: Corner Code #

1. Public Land Survey	T <u>8</u> N	R <u>14</u> W	E-8 (E 1/4 Section 20) Polkton Twp.
	T <u> </u>	R <u> </u>	
	T <u> </u>	R <u> </u>	
	T <u> </u>	R <u> </u>	
2. Property Controlling in Section	S <u> </u>	T <u> </u> R <u> </u>	
	S <u> </u>	T <u> </u> R <u> </u>	
3. Miscellaneous Property in Sec.	S <u> </u>	T <u> </u> R <u> </u>	
	S <u> </u>	T <u> </u> R <u> </u>	

RECORDED
97 DEC -8 AM 11:27

Randy Mullett
REGISTER OF DEEDS
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Randal J. Vugteveen, in a field survey on November 21, 19 97 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L
1											
2	6		5		4		3		2		1
3											
4	7		8		9		10		11		12
5											
6	10		17		16		15		14		13
7											
8	19		20		21		22		23		24
9											
10	30		29		28		27		26		25
11											
12	31		32		33		34		35		36
13											

A. Description of original monument and accessories and/or subsequent restoration:

E-8 G.L.O. survey notes 1837 John Mullett Set quarter section post 6" Ironwood S 40° E 19 links 14" Elm N 42° W 8 links	LCRC Liber 4 Page 157 Apr. 1, 1981 Cast Iron Monument West end concrete culvert W 12.0' East end concrete culvert E 12.71' Centerline cross culvert S 1.5'	Nederveld Assoc. old records 1984 SE corner Sec. 20 South 2681.18' Old County Surveyors Notes 1906 SE corner Sec. 20 South 2680.5'
---	--	---

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-8 Found cast iron monument On centerline 80th Avenue E-9 Southeast corner Section 20 South 2681.12'	Accepted position of cast iron monument as a careful perpetuation of the position of the original corner
---	---

P.A. 345 OTTAWA COUNTY

PEER APPROVED


12/1/97

Randy Mullett

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E-8 Cast Iron Monument

Set Ottawa County Remon tag & nail West side 38" Twin Oak AZ 2° 528.74'
Set Ottawa County Remon tag & nail West side utility pole AZ 176° 432.91'
Set Ottawa County Remon tag & nail East side power pole AZ 185° 600.30'
Red capped Nederveld Assoc. iron AZ 267° 15.00'
E-9 Southeast corner Section 20 South 2681.12'
On centerline 80th Avenue

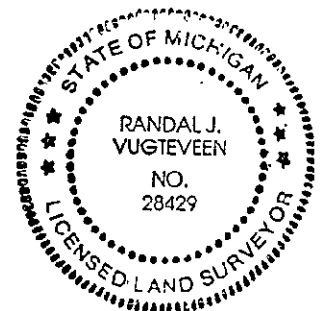

\$ 9.00 CORNER
\$ 1.00 PHOTO

Signed by *Randal J. Vugteveen*
Surveyor's Michigan License No. 28429

Date Dec 1, 1997