

SURVEY & REMONUMENTATION

FEB 27 1998

SECTION

Ottawa County Remonumentation  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Ottawa  
(County)

Located In:

Corner Code #

- 1. Public Land Survey T 9N R 13W F-5  
T R N $\frac{1}{4}$  cor. Sec. 16  
T R  
T R
- 2. Property Controlling S T R  
in Section S T R *Seg. 42 pm*
- 3. Miscellaneous S T R  
Property in Sec. S T R

RECORDED

97 DEC -8 AM 11:28

*Ray Schultz*  
REGISTER OF DEEDS  
OTTAWA COUNTY, MI

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

I, Maurice J. Rosema, in a field survey on Nov. 27, 1997 hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- F-5  
GLO - Whitcomb - 1838  
post  
12" Ash - N40°E 16 lks.  
20" Elm - S28°E 10 lks.
- LCRC per L. 4, P. 21 (1979)  
1" round iron  
PK in E side quad. 12" Maple - N 26.57'  
PK in W side 8" Maple - NNE 35.97'  
PK in NW side 10" Ash - SW 20.61'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- F-5  
Found  $\frac{1}{2}$ " rerod in mon. box, replaced with 5/8" X 2' steel rod with OC remon. cap  
Capped All-Points Surveyors rerod - S 32.82'  
On old wire fence line N-S  
E-5 (CI mon. in mon. box) - W 2636.99'  
G-5 (CI mon. in mon. box) - E 2657.60'  
1/8th line tree row to S - W 1318.5'


P.A. 345 OTTAWA COUNTY  
PEER APPROVED 12-1-97

*MJR*

I hereby accept this corner as a correct and accurate perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- F-5  
5/8" X 2' steel rod with OC remon. cap in mon. box  
Set nail and remon tag in E side 18" Oak - N3°W 47.05'  
Set nail and remon tag in S side 14" Beech - N58°E 66.58'  
Set nail and remon tag in SW side 12" Maple - S41°E 87.36'  
Set nail and remon tag in W side 15" Oak - S18°E 54.11'  
Set nail and remon tag in E side 5" Oak - S36°W 43.57'  
Centerline of E-W bit. conc. road - S 0.5'

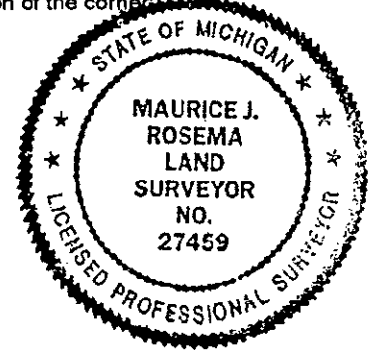

\$ 9.00 CORNER  
\$ 1.00 PHOTO

Signed by *Maurice J. Rosema*  
Surveyor's Michigan License No. 27459

Date Dec. 1, 1997