LAND CORNER RECORDATION CERTIFICATED ROLLIN 1F Ontonason County Filing Requirement of Act 74, Mich. P.A. 1970 Ontonagon County Remonumentation Conferi of 1 LC | JEW Rec. Date 12/29/98 5/ 180 Time 16:21 RECORDING FEE: 9.00 Located in: Corner Code # SURVEY & **T49N R39W** G-12 REMONUMENTATION R Т

1. Public Land Survey T R T R 2. Property Controlling T R in Section S T R 3. Miscellaneous S T R Property in Sec.

SECTION

MAR 1 0 1999

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat


5. Private Claims

For corners in

Ontonagon County

I, Joseph C. Domitrovich, in a field survey on October 9, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

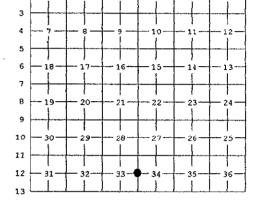

0 . . . . .

**JOSEPH** 

DOMITROVICH

CANG

A. Description of original monument and accessories and/or subsequent restoration:

## (G-12) - 1/4 Corner Common to Sections 33 & 34, T49N, R39W

1851 - Artimus Curtis set post

8" Spruce N 84° W 21 links 16" Aspen \$34° E 61 links

1985 - Robert Mick, P.S. 16936, as part of a survey for the U.S. Forest Service, recorded this corner in Liber 2, Page 186, of Corner Records at the Ontonagon County Courthouse. He re-established the corner in the centerline of US-45 on the extension of an East-West 1/4 line fence. The corner fell 22.62 feet North of a single proportionate position. He set a P.K. nail at the corner and established 2 aluminum reference monuments (R.M.) stamped with bearings and distances to the corner.

Witnesses: R.M. S 50° E 61.86 R.M. N 51° E 55.96" N 58° W Power Pole 74.39

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original corner or accessories. I found no remains of the P.K. nail set by Mick. I re-established the corner position from Mick's record ties. The distance from this corner position works well with Mick's distance to the SW Corner of Section 34. I reset a P.K. nail at the re-established Corner and added one bearing tree.

Research on file with County Remonumentation Representative.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a P.K. nail in the centerline of U.S. Highway 45 on the extension of fences to the East and West.

Witnesses:

PEER GROUP APPRILITATION R.M. S 50° 52'51" E 61.86 R.M. N 50°47'29" E 55.96 W lekai P. Pole N 59° W 74.34 County 14 73 73 5° Spruce S 81° W 128.49 12-18-98 SW Cor. Section 34 S 00°10'30" W 2661.61" (2661.58' Mick)

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by

12-18-98

Date