JUDITH D. ROEHM

Untonagon County

Page 1 of 1

LC 5/275 Time 14:50:12

JEM Date 12/22/1999

9.00

1P

## LAND CORNER RECORDATION CERTIFICATEUR FEE: Filing Requirement of Act 74, Mich. P.A. 1970


For comers in			1
ONTONAGON	Located In:	Corner Code #	
(County)			SURVEY &
1. Public Land Survey	T <u>50N</u> R	42W K-5	REMONUMENTATION
	TR TR		MAR 23 2000
Property Controlling in Section Miscellaneous	S TR S TR S TR		SECTION
Property in Sec.	S TR		Register of Deeds Stamp & File Nur

\_, Recorded Plat 4. Lot No. 5. Private Claims

Section Corner common to Sections 11, 12, 13 & 14, T50N R42W.

Farl W. Applekamp, in a field survey on Dec. 07 \_, 19 <u>99</u> do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

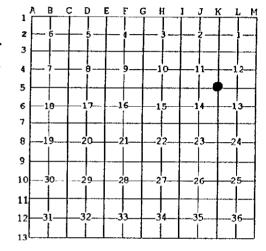

A. Description of original monument and accessories and/or subsequent restoration:

Original Corner established by Austin Burt, U.S. Deputy Surveyor, June 10, 1848. Set Ironwood Post. ORIGINAL BEARING TREES: Sugar 12", S54°E, 72 Links (47.52 Feet). Lynn 10", N50°W, (20.46 Feet). During construction of the L.P. Walsh Road, corner was restored. The drawings prepared by R.S. Scott Engineering Co. Inc., of Alpena, Michigan, dated July 29, 1967, identify the corner at Station 131+83.2 and 42 feet North of the centerline of the L.P. Walsh Road. This information was not recorded with the Register of Deeds.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner.

Based on the information above, I found a 3/4"x24" pipe with a 2" brass cap flush with the ground. I accepted this as being the only logical position for the corner. I replaced the 3/4" X24" pipe w/cap and set a monument described in "C" below.

Research on file with the Ontonagon County Remonumentation Program Representative.

PEER GROUP AFFRUNCE e w applekan DUATE OF MICHIGAN A APPLEKAMP A SURVEYOR NO. 17610 COUMTY

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: At the corner position I set a  $2\frac{1}{2}$ "X30" split base aluminum pipe with a 3" cap flush with the ground. Cap is stamped to read: County Remonumentation, T50N R42W, S11, S12, S13, S14, 1999, P.S. 17610. I established five bearing objects.

Nail in N. side of P. Pole N77°W 150.50' - Centerline of L.P. Walsh Road, South 41.65' 101.32' - 6' Steel Sign Post, Nail in N. side of P. Pole N75°E North 0.53' S11°W Nail in 7" W. Ash 137.42'

Signed by Lail W	applekan	p
Consequed Michigan License No.	7.7	17610

December 10, 1999 Date

Surveyor's Michigan License No

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971