


LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970
 Ontonagon County Remonumentation Corner

For corners in

Ontonagon County	Located in:	Corner Code #
1. Public Land Survey	T51N R37W A-13 T51N R38W M-13	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	
4. Lot No.	Recorded Plat	
5. Private Claims		

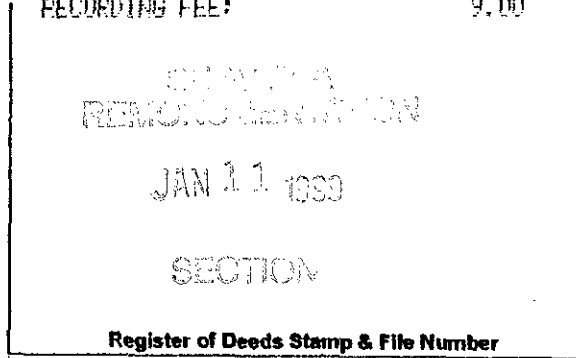

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Joseph C. Domitrovich, in a field survey on June 16, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
(A-13) Township Corner Common to Section 31, T51N, R37W & Section 36, T51N, R38W

Corner is on the 5th Correction Line

1845 - Austin Burl set post

16" Hemlock N 44° E 7 links
 8" Fir N 20° W 24 links

No subsequent record found.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original corner or accessories. I re-established the corner at a proportionate distance between the Southwest Corner of Section 36, T51N, R38W and the South 1/4 Corner of Section 31, T51N, R37W. I held the middle of an old mining road bed for the North-South position. The corner now falls in a beaver marsh in middle of submerged road bed.

Research on file with County Remonumentation Representative.


FEE GROUP APPROVED
Carl W. Goldkamp
 COUNTY REPRESENTATIVE
 6-17-98

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 1/2" x 8' aluminum rod with a 3" diameter aluminum cap stamped to read: COUNTY REMONUMENTATION; S.31, S.36; T.51N, R.37W, R.38W; S.C.; 1998; P.S. 37273. I also established two reference monuments in the middle of the old railroad grade West of the corner. Each consists of a 1/4" x 24" iron pin with a 2" diameter aluminum cap stamped "REFERENCE MONUMENT".

Witnesses:

Reference Monument #1	N 48° 25' 57" W	141.78'	
Reference Monument #2	S 43° 56' 43" W	158.88'	
Steel Sign Post	North	3.73'	
Steel Sign Post	East	2.10'	
S 1/4 Cor. Section 31, T51N, R37W	N 89° 58' 59" E	2778.36'	(2772' GLO)
S 1/4 Cor. Section 36, T51N, R38W	S 89° 52' 22" W	2646.06'	(2640' GLO)

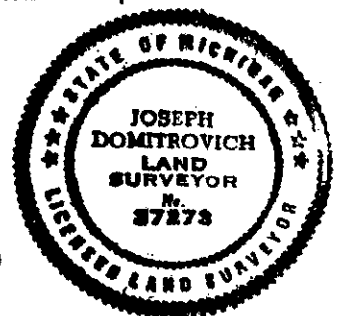

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

Signed by Joseph C. Domitrovich

Date 6-17-98

Surveyor's Michigan License No. 37273