

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Ontonagon Located In: _____ Corner Code # _____
 (County)

1. Public Land Survey	T	51N	R 40W	K-1
	T	_____	R _____	_____
	T	_____	R _____	_____
	T	_____	R _____	_____
2. Property Controlling in Section	S	_____	T _____	R _____
	S	_____	T _____	R _____
3. Miscellaneous Property in Section	S	_____	T _____	R _____
	S	_____	T _____	R _____
4. Lot No. _____, Recorded Plat				
5. Private Claims _____				

SURVEY & REMONUMENTATION
 MAY 22 1997
COMMISSION
 Register of Deeds Stamp & File Number

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Joseph C. Domitrovich, in a field survey on August 7, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(K-1) Closing corner Sections 2 & 1, T51N, R40W.

1845 - William A. Burt, intersected 60 links (39.60') east of corner and set post
 6" Tamarack S 61° E 71 links
 4" Tamarack S.11° W 57 links

1923 - E.J. Donnelly C.E., found original evidence at 1/4 corner and Section Corner 1/2 mile and 1 mile to south. He also re-established the Standard Corner Sections 35 & 36, T52N, R40W (39.60' GLO) to the west. he did not however recognize closing corners along this township line. (From his notes in copies of Original Field notes at Ontonagon County Courthouse and map on file at Ontonagon Abstract and Title.)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Original Corner and accessories have been destroyed by the draining of swamp and extensive farming.

I recovered Donnelly's Standard Corner, his 1/4 Corner to south and his Section corner to South. By re-establishing the closing corner 39.60' east of the Standard Corner, line and distances work very well with corners to south.

Therefore I re-established the closing corner 39.60' east of the Standard Corner and on line between it and the South 1/4 corner Section 36, T52N, R40W.

Research on file with County Remonumentation Representative.


PEER GROUP APPROVED
Earl W. Applekamp
 COUNTY REPRESENTATIVE 08-08-96

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner is a 2" x 30" aluminum pipe with a 3" diameter aluminum cap stamped to read: T.51N., R.40W.; S.2, S.1. C.C.; 1996; P.S. 37273. Corner falls in middle of old Township road bed running to the east, in the middle of a field, and 70' east of a field road to south.

Witnesses:

Steel Sign Post South 8.55'
 "V" Sawed in West end of Large culvert on west side of field road south S 81° W 84.96'
 5/8" capped rebar in 2" pipe West 39.60' (Standard corner Sections 35 & 36)
 Steel Sign Post N 77° W 40.56'

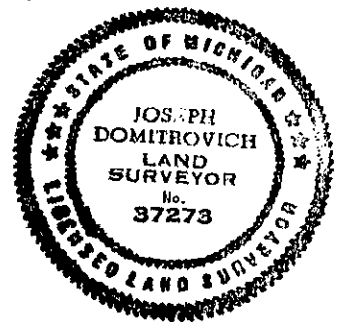

NOTE: Bearings are magnetic. Distances are to nail in side of witness objects unless noted.

Signed by Joseph C. Domitrovich

Date 8/8/96

Surveyor's Michigan License No. 37273