18

9,00

JUDITH D. ROEHM LAND CORNER RECORDATION CERTIFICATE Ontoneson County

Filing Requirement of Act 74, Mich. P.A. 4970 of 1 Ontonagon County Remonumentation Cornegec. Date 06/15/99.

5/ 195 Time 13:32

For corners in

Located in: Corner Code # **Ontonagon County T51N R40W** 1. Public Land Survey T R T R Ţ R S T R 2. Property Controlling S T R in Section T R 3. Miscellaneous S S Property in Sec.

BECORDING DENVEY & REMONUMENTATION

MAR 2 9 2000

SECTION

Register of Deeds Stamp & File Number


4. Lot No.

, Recorded Plat

5. Private Claims

I. Joseph C. Domitrovich, in a field survey on June 7, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

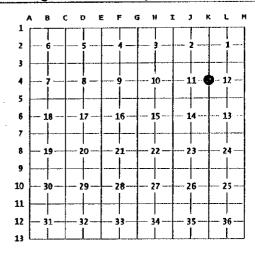

A. Description of original monument and accessories and/or subsequent restoration:

(K-4) - 1/4 CORNER COMMON TO SECTIONS 11 AND 12, T51N, R40W

1845 - William A. Burt set a sugar post.

18" Lynn

N54°E 23 links

6" Fit

N48°W 11 links

1933 - John Hawley, timbercruiser, noted, in his personal copy of the original field notes, that this corner had been "put in" by E.J.D. about 1920 but he found no. trace of it. [Probably E. J. Donnelly- an engineer who was doing surveying and platting at about this time]

1976 - Keith Sackett P.S. 19005 (Michigan DNR) notes in his field reduction notes that he found a pipe at this corner but he did not record it.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found no remains of the original corner or its accessories. Corner falls in the middle of an old grown-over North-South Road (a.k.a. the Nightmare Road.) I found a 1 ½" x 5" iron pipe in the middle of this road. This appears to be the pipe mentioned by Sackett. There is a DNR location poster on a tree to the Southwest facing the pipe and another tree scribed " ½ S. NBT" to the Northwest also facing the pipe.

Distances to Section Corners to the North and South work well with this corner. Property owners in the area know of and have accepted this pipe as the 1/2 corner for many years. I have accepted it as the 1/2 corner and replaced it with a 5/8" x 48" iron pin with aluminum cap.

Research on file with County Remonumentation Representative.

PEER GROUP APPROVED cours sunstances

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Comer is a 5/8" x 48" iron pin with a 3" diameter aluminum cap stamped to read: County Remonumentation; T51N, R40W; 1/4; S. 11, S. 12; 1999; P.S. 37273. It falls in the middle of an old marshy road in an area of large hardwoods approximately 150' south of a waist deep willow/tag alder marsh. Land to the south of this corner is also very wet and swampy.

Witnesses:

6" Hard Maple	N48°W	11.00'	(Existing Blazed and Scribed Tree
5" Elm	N85°E	20.13'	. •
Steel Sign Post	South	0.96	
8* Basswood	S25°W	6.05	(Existing DNR Location Poster)
NE Cor. Sec. 11	N00°28'16"W	2639.90'	(2640 GLO)
SE Cor. Sec. 11	S00°33'31"W	2641.63'	(2640 GLO)

NOTE: Bearings to witness objects are magnetic. Distances are to a nail in side of the witness object unless noted.

0 0100 e) DOMITROVICE

6/09/99 Date

Surveyor's Michigan License No. 37273

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14, 1975