For corners in

SURVEY & REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

APR 07 1998

Roscommon (County)	Located In:	Corner Code #
1. Public Land Survey	Sec.31T <u>23NR 4W</u> Sec. 6 T <u>22NR 4W</u> TR TB	D-13 D-1
2. Property Controlling	S T R	
in Section	S T R	
3. Miscellaneous	S T R	*-
Property in Sec.	S T R	
4. Lot No, Recorded		
Plat		
5. Private Claims		

SECTION STATE

STATE OF MICHIGAN ROSCOMMON COUNTY RECORDED

29 DEC 97 3:48 P.M.

ROBERT W. SMITH
FILE IN LIBER STOF OF LAND'S CORNERS

Register of Deeds Stamp & File Number

I, Marvin E. Myers, in a field survey on <u>December 12</u>, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. J. Brink, D.S. 1839 Mon – Post in Swamp to wet To mound 16" deep

Wit: No witnesses near

MDOT plans Job# 15911A


FRR # 72021 & FRR 68033

Sta 941+81.82 County line Sta 996+40.07 Sec. Cor. (5458.25) Sta 1049+19.00 Sec. Cor. (5278.93) Mon - No Monument indicated

Wit: None given

July 11, 1919 Beuthien, Missaukee Co. Surveyor (prior to construction of M-55?) Profile notes Sta 36+31 County line Sta 64+64 1/4 Corner (2833') Sta 91+9 Sec Cor (2645') Sta 117+60 1/4 Cor (2651')

Sta 130+35 1/8 cor (1325') Mon – None given Wit: None given

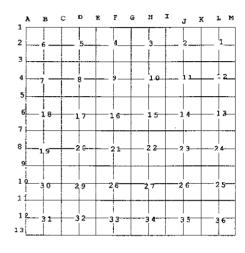

Nov 1968 G.D. Henning, R.L.S. Mon – Computed Position Wit: Iron pavement box East 2640

Vit: Iron pavement box East 2640 Iron pavement box West 2640

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
No monument or witnesses trees in the vicinity were found. Measured between existing monuments (5278.93)
Reestablishment of the position of the Government corner by proportional measure East 2639.47 (2640 GLO)
West 2639.46 (2640 GLO) Set Standard Roscommon County monument in Pavement Monument
Box.

Accepted as a careful and faithful establishment of the position of the Corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner: Mon – Standard Roscommon County Monument in pavernent box.

Wit: Nail & tag in East side (6'± above ground) Utility Pole S43°W 106.16' North edge of reflector post N85°E 99.00'

Carsonite Post S05°W in Swamp 43.35' Carsonite post at water's edge of ditch N06°E 38.1'

MARVIN E.
MYERS
PROFESSIONAL
SURVEYOR
NO.
31600
SEE

RUSCOMMON COUNTY
PEER GROUP APPROVAL

DATE 10-027,199

Marvin E. Myers, P.S. County Surveyor

marin E. Myen ment

Signed by Mann G Nugge Surveyor's Michigan License No. 31600

Date 22, 1997

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971 REVISED MAY 14,1975 REVISED JAN., 1983

LIBER 3 PAGE 489