


LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich P.A. 1970

For corners in
Roscommon County

Located in: Corner Code #

1. Public Land Survey

T24N R3W H-1
T R
T R
T R

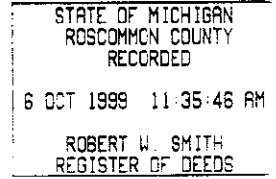

FILE IN LIBER 3 OF LAND CORNERS
Register of Deeds Stamp & File Number

I, Larry L. Cavanagh, in a field survey July 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in line 1 above was in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A. Description of original monument and accessories and/or subsequent restoration:

JOHN BRINK 1838 SET OR SEC. POST TAMARACK 10° N43°W 61 LKS TAMARACK 10° N62°E 24 LKS
GEORGE D. HENNING, CO SURVEY 1943 1/4 COR MIDWAY ON LINE 5.0' NORTH OF CENTERLINE OF PAVT B. SPRUCE 5° S46 1/2°E 59.5' N PINE 6° S43°W 57.0'
ROBERT T. OSTLING, RLS 1946 CHISLED CROSS IN PAVT 5' N OF CL B.T. SPRUCE 5° S46 1/2°E 59.5' B.T. N. PINE 6° S43°W 57.0'
HAROLD NEFF, SURVEY CHIEF (MDOT) 1966 1/2" IRON BOLT 6" J PINE 57.89' N34°E 10" J. PINE 57.03' S53°W 12" J. PINE 59.71' S44°E
LCRC 1970S LIBER 2, PAGE 506 SAME WITNESSES AS ABOVE
LARRY L. CAVANAGH, PS 1996 NO MON MATERIAL MENTIONED SPIKE IN 5' J. PINE N29°W 92.13' FORM SEAM IN N SIDE OF CON BRIDGE PIER S35°W 12.01' FORM SEAM IN N SIDE OF CON BRIDGE PIER N88°E 61.92' SPIKE IN 12' TAMARACK S44°E 162.57'

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	13	17	18	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

FRANK J. ARLETH, PS 1997
FD PAVT BOX

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


FOUND #40 SPIKE IN MEDIAN UNDER OVERPASS OF I-75 AND ALL OF L. CAVANAGH WITNESSES FROM 1996 THIS POSITION IS MIDWAY AND ON LINE BETWEEN SECTION CORNERS 2644.42' G-1 TO H-1; 2644.42' H-1 TO L-1 THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET STANDARD MONUMENT UNDER OVER PASS. CENTER OF PAVEMENT BOX IN BRIDGE DECK 20± ABOVE MONUMENT IS 0.65' NORTH OF CORNER
WIT: NAIL & TAG IN 5' J. PINE N29°W 92.13'
NAIL & TAG IN 12' TAMARACK S44°E 162.57'
FORM SEAM IN NORTH SIDE OF CONCRETE BRIDGE PIER N88°E 61.92'
FORM SEAM IN NORTH SIDE OF CONCRETE BRIDGE PIER S35°W 12.01'
CARSONITE POST S16°E 8.4'

ROSCOMMON COUNTY
PEER GROUP APPROVAL
DATE Sept 10 1999

Marvin E. Myers
Marvin E. Myers, P.S.
County Surveyor

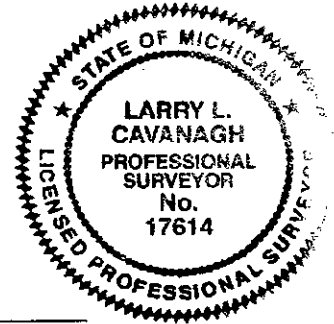

Signed by Larry L. Cavanagh
Surveyor's Michigan License NO. 17614

Date Sept. 14, 1999

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983



LIBER 3 PAGE 620

MAR 1 2000

SECTION