

MAR 16 1999

ST. CLAIR COUNTY, MICHIGAN
OFFICIAL GOVERNMENT CORNER



SECTION LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

	Located In:	Corner Code #
	Riley Township	
1. Public Land Survey	T <u>6N</u> R <u>14E</u>	<u>A-13</u>
	T _____ R _____	_____
2. Property Controlling S _____ T _____ R _____	S _____ T _____ R _____	_____
in Section	S _____ T _____ R _____	_____
3. Miscellaneous S _____ T _____ R _____	S _____ T _____ R _____	_____
Property in Sec.	S _____ T _____ R _____	_____
4. Lot. No. _____, Recorded Plat _____		
5. Private Claims _____		

REGISTER OF DEEDS
ST. CLAIR COUNTY
RECEIVED
MAY 12 1999
REGISTER OF DEEDS
ST. CLAIR COUNTY
RECEIVED
MAY 12 1999

Register of Deeds Stamp & File Number

I, John C. Niederhauser, in a field survey on October 15, 1998, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 1 CORNER, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


Original corner was made on a 6" elm tree by William Preston on January 26, 1817. This corner is common to four townships, M-13 of T6N-R13E, M-1 of T5N-R13E, and A-1 of T5N-R14E. Nothing listed on Old County Surveyors Record. Survey by M.O. Peck in November 1936, found a cedar post under a large stone and replaced all with concrete monument and set witness monuments as well. Buckley Collins found and recorded an old iron in pavement, October 1974, see LCRC Liber 3, page 307. H. Kobs found and recorded a PK nail, June 1982, see LCRC Liber 5, page 238. R. Kreger found and recorded a 3/4" iron in pavement, December 1991, see LCRC Liber 6, page 436. R. Birkett in a survey for Macomb County Remonumentation recovered a squared boat spike in monument box and replaced spike and recorded a set 3/4" iron with a 2" diameter aluminum cap stamped Macomb County Monument, MI Act 345 in an existing monument box, see Macomb County LCRC Liber 7783, page 254.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found a 3/4" iron rod with a 2" diameter Macomb County Remon cap stamped #41094 in an existing monument box at the center of intersection of Boardman Road (asphalt) and Miller Road to north (gravel) and Omo Road to south (gravel). Verified corner using previously recorded corner witnesses, also checked distances to quarter corners listed on recorded surveys: East to S1/4 corner Section 31 of T6N-R14E, 4149.34'(M), 4149.25'(R). West to N1/4 corner Section 1 of T5N-R13E, 2784.97'(M), 2784.36'(R). North to E1/4 corner of Section 36 of T6N-R14E, 2692.58'(M), 2692.51'(R).

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Did not disturb and accepted as corner the 3/4" iron rod with a 2" diameter Macomb County Remon cap stamped #41094 in an existing monument box at the center of Boardman Road, Miller Road (north) and Omo Road (south). This corner is common to four township: M-13 of T6N-R13E, M-1 of T5N-R13E, and A-1 of T5N-R14E.
 N 30°E 26.40' to NE corner of north end of curved concrete headwall.
 N 50°E 36.70' to set PK nail with SCC Remon Tag in SE side of utility pole.
 S 30° E 42.98' to set PK nail with SCC Remon Tag in NE side of utility pole.
 S 25° E 35.18' to chiseled "X" on west end of rock headwall.
 S 50° W 46.60' to a found iron capped #19835.

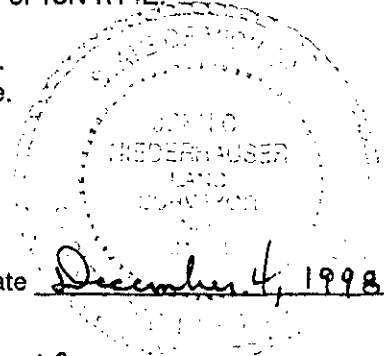

Signed by John C. Niederhauser APPROVED DEC. 3, 1998 Date December 4, 1998

Surveyor's Michigan License No. 24608