

SCHOOLCRAFT COUNTY PEER GROUP APPROVED

SURVEY & REMONUMENTATION

DATE 10/15/97

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

JAN 21 1998

For corners in

Schoolcraft
(County)

Located In:

Corner Code #

1. Public Land Survey	T <u>42N</u> R <u>16W</u>	I-10
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

SECTION

Received & Filed this 9 day of
Dec 1997 at 3:45 P M
Sigrid I. Hedberg
Schoolcraft Co. Reg. of Deeds

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Thomas P. O'Brien, in a field survey on Nov. 3, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		10		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27	X	26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


I-10 E 1/4 Corner Section 27
Aug. 13, 1850 - Algernon Merryweather D.S set qr. section post.
Sugar 14 in. N54W 44 lks. do 10 in. S75E 19 lks.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-10 Nov. 3, 1997 - Thomas P. O'Brien P.S. reestablished corner by single proportionate measurement. No evidence of GLO survey or subsequent restoration recovered. Set I.B. with O'Brien cap #21274 in monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-10 1/2" I.B. with O'Brien cap #21274 in monument box.
Witnesses: NBT 10" Beech - S68°E - 82.0'
NBT 14" Beech - S23°E - 85.07'
Power Pole - S72°W - 31.32'
Taylor Rd. sign post - N47°W - 40.40'
4" Cedar Post - East - 30.0'

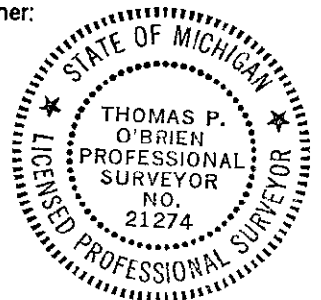

Signed by Thomas P. O'Brien P.S.

Date November 28, 1997

Surveyor's Michigan License No. 21274