

66

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Schoolcraft

(County)

Located In:

Corner Code #

1. Public Land Survey

T ___ R ___
T ___ R ___
T ___ R ___
T ___ R ___

2. Property Controlling in Section

S 34 T 46N R 13W ___
S 34 T 46N R 13W 11

3. Miscellaneous Property In Sec.

S ___ T ___ R ___
S ___ T ___ R ___

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

Aug 14 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19___ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


(11-Sec. 34) Southwest 1/16 corner, Section 34. Corner not established in the original survey. Found no subsequent record.
(12-Sec. 34) South 1/16 corner, Section 34. Corner not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(11-Sec. 34) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/16 corners, all monumented. At the position for the corner, I placed a 1" I.D. x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by T.Stark, Newberry District Office.
(12-Sec. 34) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a straight line between Quarter corner 1316.60' South, and Center of Section 1316.60' North. At the position for the corner, I placed a 1" I.D. x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by T.Stark, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(11) Set 1" pipe with 4" MDNR cap. Blazed, scribed, and set measuring nails in the following: 5" Balsam N23E 26.2' "SW1/16 BT" 8" Tamarack N09E 35.55' "SW1/16 BT" 4" Balsam S75W 14.3' "SW1/16 BT" 4" Balsam S45W 16.4' "SW1/16 BT" Placed a 3" squared and scribed cedar post adjacent. Bearings are magnetic.	(12) Set 1" pipe with 4" MDNR cap. Blazed, scribed, and set measuring nails in the following: 7" Spruce N08E 11.95' "S1/16 BT" 6" Spruce N63W 22.1' "S1/16 BT" 3" Cedar S74W 5.4' "S1/16 BT" 4" Balsam S60E 5.8' "S1/16 BT" Placed a 4" squared and scribed cedar post adjacent. Bearings are magnetic.
--	---

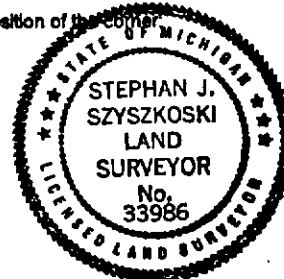

Signed by

Stephan J. Szyszkoski

Date

8/27/98

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division