

67

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Schoolcraft	Located In:	Corner Code #	
(County)			
1. Public Land Survey	T 46N R 13W	H12	
	T R		
	T R		
	T R		
2. Property Controlling In Section	S 34 T 46N R 13W	8	
	S T R		
3. Miscellaneous	S T R		
Property in Sec.	S T R		

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Aug 19 1997

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	10	11	12	13	14	15							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

(H12) Center of Section 34. Corner not established in the original survey. Found no subsequent record.
(8-Sec. 34) West 1/16 corner, Section 34. Corner not established in the original survey. Found no subsequent record.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(H12) Found no evidence of prior monumentation at the corner position. Established the corner at the intersection of straight lines connecting opposite 1/4 corners 2624.87' North, 2633.27' East, 2633.21' South, and 2632.39' West. At the position for the corner, I placed a 1" I.D. x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by T.Stark, Newberry District Office.

(8-Sec. 34) Found no evidence of prior monumentation at the corner position. Established the corner midway and on a straight line between Quarter corner 1316.19' West and Center of Section 1316.19' East. At the position for the corner, I placed a 1" I.D. x 36" iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by T.Stark, Newberry District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(H12) Set 1" pipe with 4" MDNR cap.	(8) Set 1" pipe with 4" MDNR cap.
Fence post, nail/tag in top, 164.1'	Blazed, scribed, and set measuring nails
Fence post, nail/tag in top, 196.2'	in the following:
Blazed, scribed, and put measuring nails	10" J. Pine N05W 65.95' "W1/16 BT"
in the following:	12" Twin J. Pine N55E 48.7' "W1/16 BT"
18" Maple clump S86W 319.1' "CS BT"	10" J. Pine N85E 48.0' "W1/16 BT"
16" Maple S76W 303.3' "CS BT"	8" Aspen S75W 52.5' "W1/16 BT"
Placed a 4" squared and scribed cedar	Placed a 4" squared and scribed cedar
post adjacent. Bearings are magnetic.	post adjacent. Bearings are magnetic.

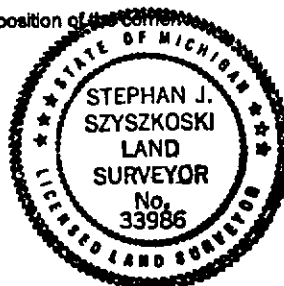

Signed by

Stephan J. Szyszkoski

Date

8/27/98

Surveyor's Michigan License No.

33986

For the Michigan Department of Natural Resources - Forest Management Division