

17

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Schoolcraft

(County)

Located In:

Corner Code #

1. Public Land Survey

T47N R 13N A9

T47N R 13N 87

T R

T R

2. Property Controlling
in Section

S T R

S T R

3. Miscellaneous
Property in Sec.

S T R

S T R

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

May 21 1996

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7	●												
8	19	20	21	22	23	24							
9	●												
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

(A9) Corner common to Sections 19-30 T47N13W and 24-25 T47N14W. Corner re-monumented in 1956 by Billy D. Buckler, RLS, from two original 8fs. Corner monumented with a 1" pipe with 4" brass cap and the following: 20" N. Pine S87W 170 links, 18" R. Pine N36W 168 links.

(B7) Quarter corner common to Sections 18-19. Corner re-established in 1959 by Billy D. Buckler, RLS, by proportionate measurement. Corner monumented with a 1" pipe with 4" brass cap and the following: 18" N. Pine stump N40W 59 links, 36" N. Pine stump S08E 94 links, 18" N. Pine stump N72E 49 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(A9) Found the 1956 monument, as described, in good condition, and at record bearing and distance from the 1956 witnesses, now both found as cut stumps. The 18" N36W has measuring notch showing. Left the monument in place and marked 4 new accessories as described below. Corner re-witnessed by T. Stark and D. Lampela, Newberry.

(B7) Found the 1959 monument as described, in good condition, and at record bearing and distance from the remaining 1959 witness 18" N. Pine stump N40W 59 links. The other two witness stumps have been destroyed. Left the monument in place and marked 4 new accessories as described below. Corner re-witnessed by J. Stark and D. Lampela, Newberry.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(A9) Found 1" pipe with 4" brass cap. Blazed, scribed, and set measuring nails in the following:


5" W. Pine S66E 26.45' "S30 NBT"
30" W. Pine S69W 135.1' "S25 NBT"
10" R. Pine N11W 29.05' "S24 NBT"
8" R. Pine S34E 23.65' "S30 NBT"

Placed a squared and scribed cedar post adjacent. Bearings are magnetic.

(B7) Found 1" pipe with 4" cap. Blazed, scribed, and set measuring nails in the following:

27" W. Pine 29E 49.00' "N45 NBT"
11" W. Pine S88W 23.45' "N45 NBT"
11" W. Pine N34W 39.40' "S25 NBT"
6" Pine N69E 30.90' "N45 NBT"

Placed location tag on blazed 2" W. Pine S8W approx 133' from corner. Bearings are magnetic.

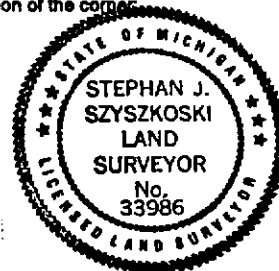

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 6/25/96

For the Michigan Department of Natural Resources - Forest Management Division