## SUMVEY & REMONUMENTATION

NOV 1 0 1997

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

97 NOV -5 PM 2: 37

SHIAWASSEE COUNTY, HICH.

REGISTER OF DEEDS

•
COMMISSION

For corners in

5. Private Claims

Shiawassee (County)	Located in:	Corner Code #
1. Public Land Survey	T_6N R2E T R T R T R	K-10
Property Controlling     In Section     Miscellaneous     Property in Sec.	STR STR STR STR	
4. Lot No	. Recorded Plat	

Register of Deeds Stamp & File Number

G Н

C AB

ű

ĕ

ā

9

10

DEF

I, Mark L. VanRaemdonck, in a filed survey on June 5, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
  - 1. Original: Joseph Wampler, D. S.

Mon: Wood Post

Access: W Oak 13 S 9 1/2 W 177 LKS B Oak 18 S 43 E 165 LKS

2. Ezra Mason, County Surveyor, Book B-C, P. 146-147, 12/2-3/1868

Mon: None Given Access: S36 1/2° W 45 4" Sugar N28 3/4°W 65 5" Sugar


3. Bernard Griggs, R. L. S. #14763, Cert. Survey, Rec. L. 2, P. 113-120, 11/18/74 Mon: Found 1" Pipe
Access: West 32.89' C. P. Co. Pipe
S20°E 96.65' Nail in Pole
S30°W 114.86' Nail in P. P.

4. Mark L. VanRaemdonck, Unrecorded Survey 12/4/86

Mon: None Given

Access: Bearings and distances to other Section corners

(Continued on next page)

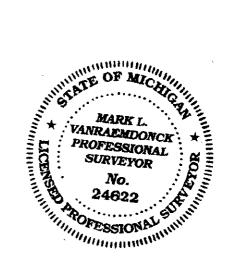

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner

Found 3/4" Pipe as referenced in No. 2, 3, 4 and 5. Accepted the pipe as the location of the original corner location based on the best available evidence. Found no conflicting evidence.

C. Description of monument for corner and accessories to perpetuate locating the position of the corner

Removed 3/4" pipe and installed a standard Shiawassee County Harrison Marker, stamped "Remon 24622". The marker is witnessed by the following accessories:

North

2640.64 Harrison Marker at K-9

West 4.24 Centerline asphalt surface West 33.00

2" Pipe Cons. Power Co. Property corner 2" Pipe corner fence post 43.45 East

S30°W N&T #24622 in E, face 12" Cedar

South 2631.97 Harrison Marker at K-11

Signed by

Date <u>OCT 30, 1997</u>

PROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS JAN 18, 1971 REVISED MAY 14, 1975 REVISED JAN., 1983

SHEET #1 OF Z

LIBER SUB PG 228

Surveyor's Michigan License No.\_ 24622

## A. Description of original monument and accessories and/or subsequent restoration:

(Continued from front)

Mark L. VanRaemdonck, Cert. Survey Rec. L. 7, P. 042 6/30/1994 5. Mon: Found 3/4" Pipe

Access: West 4.24 Centerline asphalt West 32.98' 2" Pipe Con. Power Prop. Cor. East 43.45' 2" Pipe Fence Cor. Post S30°W 60.70' Set N&T E. face 12" Cedar

6. Mark L. VanRaemdonck, Cert. Survey Rec. L. 7, P. 339 Mon: Found 3/4" Pipe Access: West 4.24' Centerline asphalt

West 32.98' 2" Pipe Con. Power Prop. Cor. East 43.45' 2" Pipe Fence Cor. Post S30°W 60.70' Set N&T E. face 12" Cedar

SURVEY & REMONUMENTATION

NOV 1 0 1997

COMMISSION

5 HEET #2 OF 2