NOV 1 0 1997

5. Private Claims

COMMISSION.

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

97 NOV -6 PM 2:38

REGISTER OF DEEDS.
SHIAWASSEE COUNTY, MICH.
,
3

For corners in Located in: Corner Code # **Shiawassee** (County) 1. Public Land Survey R_4E 2. Property Controlling In Section 3. Miscellaneous Property in Sec. 4 Int No Recorded Plat

I, Mark L. VanRaemdonck, in a filed survey on March 20, 1997, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
 - 1. Original John Mullett, D.S. 1823

Mon: Wood Post

Access: Beech 15 S28W 57 LKS Beech 9 N47E 10 LKS

2. Edwin J. McCombs, L. C. R. C. Rec. L. 1, P. 53 6/29/72

Mon: Found 3/4" pipe in road intersection
Access: N40W 48.5" T. Pole
N50W 38.54 Road Sign
S50W 46.7 Pipe Line Marker

- 3. Consumers Power Co. Unrecorded Survey 6/16/72

 Mon: Found 3/4" Pipe 0.5 E of centerline blacktop

 Access: T. Pole N40W 48.5

 Rd. Sign N50W 38.54 Pipeline marker S50W 46.7
- Norm C. Caldwell, L. C. R. C. Rec. L. 2, P. 607 Mon: Found R. R. Spike Over 5/8" Pipe Access: N30W 48.46 PK&T E. face T.P.

N45W 47.44 Chis. Not. W. edge Rd. Sign Post \$45W 46.35 Chis Not. S. edge Gas P. L. sn post \$70E 76.07 Pun. Hole T. C. W. end 15" CMP N40E 47.34 Conc. Mon. (Top 12" Brok. & Bent)

Mark L. VanRaemdonck, Cert. Survey Rec. L. 6, P. 835, May 26, 1994
 Mon: Found 3/4" Pipe in Road Intersection

(Found R.E.I. Iron in Mon. Box) ss: N40W 48.5 T. Pole N50W 38.54 Road Sign S50W 46.7 Pipe Line Marker

Surveyor's Michigan License No.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Found R.E. I. Rerod & Cap in Mon. Box as referenced in No. 3 above and is accepted as the best available evidence of the position of the original corner. Found no conflicting evidence.

C. Description of monument for corner and accessories to perpetuate locating the position of the corner

Installed a standard Shiawassee County Harrison Marker, stamped "Remon 24622." The marker is witnessed by the following accessories:


N45°E 64.41' P. K. & Tag #24622 in W. face 6" Pine

S70°E 72.70' Rivet Top Cen. W. end 12" CMP Culv.

Top Cen. Gas Valve North one of two valves Top Cen. Tele. Cable Box 57 27

Date OCT. 29, 1997

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS JAN 18, 1971 REVISED MAY 14, 1975

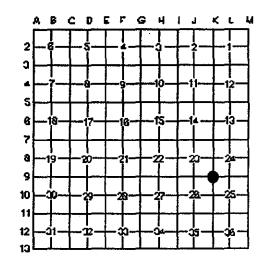

Register of Deeds Stamp & File Number

APPROVED

County Remonumentation Peer Review Group

> NLC 31 OCT 97



REVISED JAN., 1983