SUFVEY & REMONUMENTATION

MAY - 1 1995

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

For	corners	in


5. Private Claims

COMMISSION

94 NOV 16 PM 3: 45

Programme and the second secon		- 10 11 0 40	
Shiawassee	Located in:	Corner Code #	REGISTER OF DEEDS
(County)			
			SHIAWASSFE COUNTY. MICH.
1. Public Land Survey	T_7NR_3E	(M-12)	SHIAWASSEE COUNTY, MICH.
1. Tablic Land Odirey	T R	100-12/	
	TR		
	TR	 	
2. Property Controlling	STR		
in Section	STR		
3. Miscellaneous	STR		Register of Deeds Stamp & File No
Property in Sec.	STR		Tragastra of December 1 inc inc
			<u> ABCDEFGHIJ</u>
4. Lot No.	Recorded Plat		

ip & File Number

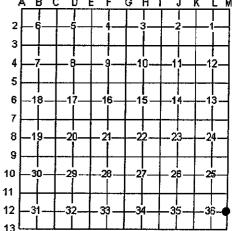

I, Mark L. VanRaemdonck, in a filed survey on October 21, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the current points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, remonumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration;
- 1.) Original: Joseph Wampler, D.S.

Monument: Wood post

Accessories: Hickory 5 N4°E 141/ Hickory 9 S10°W 26

2.) Monroe Holley, Deputy County Surveyor. Book A, page 113. 03/28/1854

Monument: Not given

Accessories: W. Oak 10" S48°E 36 Cherry 11" S44°W 31

3.) Ezra Mason, County Surveyor. Book A, page 159. Book B, page 91. 01/02/1861

Monument: Not given

Accessories: W. Oak 10" S57 3/4°E 39% W. Oak 10" S13 3/4°E 40

APPROVED

County Remonumentation Peer Review Group 9/27/94 M.L.V.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Original monument and accessories have been obliterated. Accessories from Holley and mason surveys have been obliterated. The location of the East and West ¼ line fence in the Southeast ¼ of Section 36 fit well with Mason's 1861 survey. Based on proportional measurements from Mason's survey along the East and West 1/2 line I re-established the corner location. Excavation revealed no evidence. There is a row of large boulders and rocks running South from this location. This location if accepted as the careful and faithful re-establishment of the original corner location based on the best available evidence.

C. Description of monument for corner and accessories to perpetuate locating the position of the corner:

Set standard Harrison marker stamped "REMON 24622" and witnessed by the following accessories:

S80°E 12.73' Set N&T in North face 15" Red Oak N80°W 10.21' Set N&T in South face 12" Red Oak

S35°W 36.10' Set N&T in East face 6" Linden

Surveyor's Michigan License No. 24622

South 26.24' Set N&T in West face 4" Hackberry

VANRAEMDONCK LAND SURVEYOR No. 24622 RED LAND

mark l

www. OF MICHIGA

L. Infantish

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVE VEYORS JAN 18, 1971) REVISED MAY 14, 1975 REVISED JAN., 1983

IBER IR