

1999 REMONUMENTATION PROGRAM

COPY

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Vassar Township

<u>Tuscola</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>11</u> NR <u>8E</u>	<u>K-11</u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
	T <u> </u> R <u> </u>	<u> </u>
2. Property Controlling in Section	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
3. Miscellaneous Property in Sec.	S <u> </u> T <u> </u> R <u> </u>	<u> </u>
	S <u> </u> T <u> </u> R <u> </u>	<u> </u>

RECEIVED FOR RECORDS
LIBER NO. _____ PAGE NO. _____
FILE NO. 4106
Vassar Twp
99 DEC 21 PM 3:41
TUSCOLA COUNTY
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

Lionel Roy Emery
I, P.S. #24593, in a field survey on July 16, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		10		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

June, 1822 G.L.O. Notes, Joseph Fletcher, D.S. Set corner to Secs. 25, 26, 35 & 36, Hemlock 16" N69°W 14 links, Hemlock 16" South 20 links. March 17, 1892 Survey of Sec. 25 by G. B. Felton, County Surveyor, from B.T., Elm 8" N1 1/2°E 425 links, Pine 30" S67°E (no dist. given). Dec. 1, 1898 Survey of Sec. 26 by Edward L. Teskey, County Surveyor, set by Geo. Felton. April 24, 1971 L.C.R.C. Page 8 by David T. Rowe, P.S. #11192, found nail & washer, replaced with "T" iron, S35°W 43.10' rd. sign post, North 2.8' centerline road E-W. Sept. 30, 1971 Survey L-1, P-290 & 291 by David T. Rowe, P.S. #11192, object & accessories same as L.C.R.C. Page 8. Note: Survey drawing indicates "T" iron set NE of corner K-11 at 50' East & 50' North.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Sec. A con't on back of form.

Found "T" iron in monument box and accepted same as the best evidence of the original corner position.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


Removed "T" iron & perpetuated with 5/8" iron rod & standard brass cap stamped K-11, T11N-R8E. Encased rod & cap in concrete in monument box. N40°E 89.54' set remon. tag over found tag #32332 in NW face P. Pole. S40°E 40.84' set 1/2" iron rod in road shoulder. S45°W 58.32' set remon. tag in N. face 4" x 4" wood post. N45°W 37.22' set 1/2" iron rod in road shoulder.

Due to the untimely illness of Mr. Emery, I, Kenneth D. Dunton, P.S. #23503, have reviewed Mr Emery's field notes and have prepared this form.

Signed by [Signature]
Surveyor's Michigan License No. 23503

Date 12-13-99

APPROVED
12-13-99
KUL
RLB
gmg

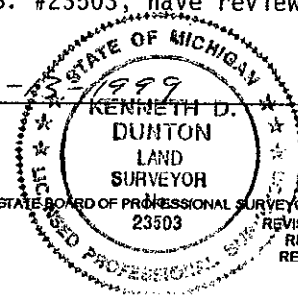

COPY

Sec. A Con't.

Feb. 12, 1973 Survey L-468, P-773 & 774 by David T. Rowe, P.S. #11192, same object and accessories as L-1, P-290 & 291. Aug. 27, 1975 & revised Sept. 2, 1975 & Sept. 11, 1975 Surveys L-453, P-490 & 491 and L-458, P-198 & 199 by James A. Beck, P.S. #21559, same object and accessories as L-468, P-773 & 774. Dec. 21, 1988 Survey L-590, P-1143 & 1144 by Stephan J. Szyszkowski, P.S. #33986, found "T" iron, N60°E 41.73' stop sign post, N45°E 89.37' found tag #11192 in P. Pole, North 3'± centerline E-W gravel road, S45°E 37.00' set 1/2" rerod at edge asphalt surface, S45°W 35.71' set 1/2" rerod at edge asphalt surface 3.9'± NE of stop sign.

