

DEC 07 1994

COPY

COMMISSION

1994 REMONUMENTATION PROGRAM  
LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in KOYLTON TOWNSHIP

RECEIVED FOR RECORD  
LIBER NO. \_\_\_\_\_ PAGE NO. \_\_\_\_\_  
FILING NO. 435  
KOYLTON TWP.  
94 NOV -9 PM 2:20  
VIRGINIA H. McLAREN  
TUSCOLA COUNTY  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

<u>TUSCOLA</u> (County)	Located In:	Corner Code <u>##</u>
1. Public Land Survey	T <u>11N</u> R <u>11E</u>	<u>M-6</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

	A	B	C	D	E	F	G	H	I	J	K	L
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												


I, Lionel Roy Emery, in a field survey on June 23, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:  
1834 (Gov't. Land Office Notes) Harvey Parke, D.S. -Set quarter section post- Elm 17 S12W 15;  
B. Ash 11 N17W 27  
1974 (Survey -Liber 438, page 726) Robert G. Kay, P.S. 14096 -set 1/2" iron- N40°W 68.75' Nail Wood Post; N80°E 17.20' Nail 6" Maple; S35°W 49.20' Nail 28" Stump

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
Found 1/2" diameter Iron rod. No accessories found. Measured distance South to Southeast corner (M-7) of Section 13 and distance matched Kay's  
Accepted found marker as marking original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
Removed iron and replaced with Standard Tuscola County Concrete Monument w/2" Brass Cap stamped M6 T11N / R11E  
S35°E, 48.64' T.C. Remon. tag in SW face of 18" Elm  
S08°E, 104.53' T.C. Remon. tag in NE face of 7" Elm  
S22°W, 57.38' T.C. Remon. tag in West face of 8" Elm  
West, 109.50' T.C. Remon. tag in North face of 16" Multi-trunk Elm

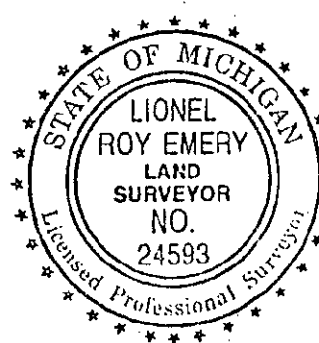

Signed by Lionel Roy Emery Date Aug. 31, 1994  
Surveyor's Michigan License No. 24593

APPROVED  
8-31-94  
*[Signature]*

COPY

