SURVEY & REMONUMENTATION

FEB 08 2001



SECTION

2000 REMONUMENTATION PROGRAM LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74,


	Filing Requirement of Act 74, Mich. P.A. 1970	RECEIVED FOR RECORD	
or corners in: JUNIATA TWP		LIBER NO PAGE NO. FILE NO. # 100 Juniata	
Tuscola Located In:	Corner Code #	00 DEC 19 PH 1: 34	
1. Public Land Survey ד ד ד ד	12N R 8E L-7 R R R	TUSSOLA COUNTY	
2. Property Controlling	S R	TANGE OF OUR PRINTING	
in Section	S R	Register of Deeds Stamp & File	
3. Miscellaneous	S R	Number	
Property in Sec.	S		

4.	Lot	No.	 ,	Recorded	Рlа

5. Private Claims

I, <u>Kari M. Lohela</u>, in a field survey on <u>November 11</u>, 20 00 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

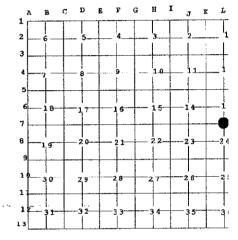

A. Description of original monument and accessories and/or subsequent restoration:

1822 G.L.O. NOTES, ORANGE RISDON, D.S., SET 1/4 POST, HEMLOCK 20 N 68 E 19, BEECH 6 S 48 W 19

NOV. 11, 1975, LCRC P.14 JUNIATA TWP., DAVID ROWE, PS 11192, FOUND NOTHING. SET T IRON AS OCCUPIED AT INTERSECTION OF VICKORY AND BALL ROADS. N45°W 45.72' NAIL & FLAGGING IN P.P., N45°E 39.02' NAIL & FLAGGING IN T.P., N65°E 49.13' CENTER OF ROAD SIGN

DEC. 5, 1975, SURVEY L.457 PP.770-772, JAMES BECK, PS 21559, FOUND 5/8" RE-ROD IN PLACE, N45°W 45.72' NAIL & FLAGGING IN P.P., N45°E 39.02' NAIL & FLAGGING IN T.P., N65°E 49.13' CENTER OF ROAD SIGN, SOUTH 23.76' PK & FLAGGING IN FENCE POST

JUNE 6, 1976, SURVEY L.461 PP.185-186, DAVID ROWE, PS 11192, FOUND 5/8" RE-ROD, N45°W 45.72' NAIL & FLAGGING IN P.P., N45°E 39.02' NAIL & FLAGGING IN T.P

JUNE 28, 1976, SURVEY L.462 PP.928-930, DAVID T. ROWE, PS 11192, FOUND 5/8" RE-ROD & CROCKERY, S65°E 3.85' TO 5/8" RE-ROD, N40°W 42.25' NAIL & FLAGGING IN P.P., N45°E 40.43' NAIL & FLAGGING IN T.P., N55°E 45.78' CENTER OF ROAD SIGN POST, S05°E 25.32' PK NAIL & FLAGGING IN FENCE POST, S05°E 34.72' FOUND ¾" PIPE

JULY 19, 1976, LCRC P.24 JUNIATA TWP., DAVID ROWE, PS 11192, FOUND OLD CORRODED 5/8" RE-ROD W/ABUNDANT OLD POTTERY, CROCKERY, S65°E 3.85' TO 5/8" RE-ROD, N40°W 42.25' NAIL & FLAGGING IN P.P., N45°E 40.43' NAIL & FLAGGING IN T.P., N55°E 45.78' CENTER OF ROAD SIGN POST, S05°E 25.32' PK NAIL & FLAGGING IN FENCE POST

NOV. 1, 1976, SURVEY L.467 P.801, DAVID ROWE, PS 11192, NO MENTION OF OBJECT OR ACCESSORIES

MAY 14, 1979, SURVEY L.498 P.1162, JAMES QUIST, PS 25868, FOUND 5/8" RE-ROD & CROCKERY, N40°W 42.25' NAIL & FLAGGING IN P.P., N45°E 40.43' NAIL & FLAGGING IN T.P

JAN. 18, 1978, SURVEY L.487 PP.202-204, KENNETH DUNTON, PS 23503, NO MENTION OF OBJECT OR ACCESSORIES

SECTIONS A., B., AND C. CONT. ON BACK OF FORM

FEB 08 2001

1-7 T12N-R8E

SECTION

JULY 15, 1982, SURVEY L.536 PP.1309-1310, DAVID ROWE, PS 11192, FOUND 5/8" RE-ROD & CROCKERY, N40°W 42.25' NAIL & FLAGGING IN P.P., N45°E 40.43' NAIL & FLAGGING IN T.P, S65°E 3.85' TO 5/8" RE-ROD

AUG. 7, 1987, SURVEY L.578 P.38, KENNETH DUNTON, PS 23503, FOUND SAME OBJECT AND ACCESSORIES AS SURVEY L.536, PP.1309-1310

DEC. 15, 1987, SURVEY L.578 PP.1255-1257, KENNETH DUNTON, PS 23503, NO MENTION OF OBJECT OR ACCESSORIES

JUNE 22, 1988, SURVEY L.583 P.1230, KENNETH DUNTON, PS 23503, FOUND SAME OBJECT AND ACCESSORIES AS SURVEY L.536, PP.1309-1310

Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 5/8" BAR AND NUMEROUS PIECES OF BLUE CROCKERY. RECOVERED 4 ACCESSORIES WHICH INDICATE THAT 5/8" BAR IS IN SAME POSITION AS SURVEYS STARTING IN 1976, AND 1976 LCRC CITED ABOVE.

ACCEPTED 5/8" BAR AS BEST AVAILABLE EVIDENCE OF ORIGINAL CORNER POSITION.

Description of monument for corner and accessories established to perpetuate locating the position of

RAISED 5/8" BAR WITH 5/8" BAR AND SET STANDARD BRASS CAP STAMPED L-7, T12N-R8E. ENCASED CAP AND BAR IN CONCRETE IN NEW MONUMENT BOX.

N45°E, 53.10' SET REMON. TAG & NAIL ABOVE FOUND PK NAIL & TAG IN W. FACE OF CUTOFF UTILITY POLE N65°E, 45.60' CENTER OF STEEL ROAD SIGN POST

\$65°E, 3.85' FOUND 5/8" REBAR

SOUTH, 44.82' SET REMON. TAG & NAIL ABOVE FOUND NAIL & WASHER IN W. FACE OF 18" PINE S40°W, 53.72' SET REMON. TAG & NAIL IN N. FACE OF 6" PINE

N35°W, 42.06' SET REMON. TAG & NAIL ABOVE FOUND PK NAIL IN E. FACE OF UTILITY POLE

signed by ei h. Cle

Date 12/18/20 APPROVED BY TUSCOLA COUNTY /300 REMONUMENTATION PEER GROUP MWP

12/14/2000 RRB

APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 197 REVISED MAY 14,197

REVISED JAN., 198 REVISED OCT., 199

C PROFESSIONAL NO. 44289

Surveyor's Michigan License No. 44289

FEB 08 2001

T12N-R8E



1822 RISDON 2636.70' 1976 ROWE 2644.72' 2000 LOHELA 2644.96'

SECTION 13

1822 RISDON 2636.70' 1975 BECK 2650.11' 1987 DUNTON 2653.85' 2000 LOHELA 2653.83'

L-7 K-7 **ROAD** BALL SECTION LINE -1976 ROWE 88*13'00" 2000 LOHELA 88*12*48* 2000 LOHELA 91'46'31" 2000 LOHELA 179'52'16" TOWNSHIP LINE SECTION LINE ROAD 1821 1993 2000 SECTION 23 SECTION 24 1993 DUNTON 180°05°35° 2000 LOHELA 179°50'36° K−8 € 2000 LOHELA 180°02'07" T12N-R8E UNADJUSTED ERROR OF CLOSURE = 1/36,892ADJUSTED BY COMPASS RULE WASHBURN 1978 ROWE 91°25'38" 2000 LOHELA 91°25'38" 2000 LOHELA 180'31'10" 2000 LOHELA 88'18'54" 57.72 SECTION LINE-1822 RISDON 2630.10* 1978 ROWE 2636.25' 2000 LOHELA 2636.59' . 1822 RISDON 2630.10* 2000 LOHELA 2643.39* M-9K-9 L-9 W.M.

SECTION 25

SECTION 30 INDIANFIELDS TOWNSHIP