

MAR 02 1999

RECEIVED FOR RECORD

LIBER NO. _____ PAGE NO. _____

1998 REMONUMENTATION PROGRAM

FILE NO. #68 Columbia Twp.

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

98 DEC 18 AM 10:08

For corners in COLUMBIA TOWNSHIP

TUSCOLA

(County)

Located in:

Corner Code #

1. Public Land Survey

T 14N R 9E M-8

T R

T R

T R

2. Property Controlling in Section

S T R

S T R

3. Miscellaneous Property in Sec.

S T R

S T R

Gregory M. Emery

TUSCOLA COUNTY REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, LIONEL ROY EMERY, in a field survey on OCT. 16, 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	16		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

1835 GLO NOTES (PG. 135); HERVEY PARKE, DEP. SUR. SET QR. SEC. POST; CEDAR 12 S24W 35; HEMLOCK 15 N5W 23 1895 COUNTY SURVEYOR'S RECORD (PAGES 260 AND 261) BY: EDWARD L. TESKEY, COUNTY SURVEYOR'S SURVEY OF SECTION 24, T14N-R9E; STAKE-ESTABLISHED AT PROPORTIONATE DISTANCE BETWEEN SECTION CORNERS

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

ALL EVIDENCE OF CORNER MARKING IS LOST EXCEPT FOR FIELD DIVISION LINE EAST AND WEST REESTABLISHED CORNER POSITION BY SINGLE PROPORTION METHOD, THIS POSITION IS IN AGREEMENT WITH FIELD DIVISION (NO FENCES) CULTIVATION LINES ONLY.

ACCEPTED SINGLE PROPORTION POSITION AS A CAREFUL AND FAITHFUL REESTABLISHMENT OF THE POSITION OF ORIGINAL GOVERNMENT CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


SET STANDARD TUSCOLA COUNTY CONCRETE MONUMENT WITH 2 IN. DIA. BRASS CAP STAMPED M8 T14N R9E -PLACED MONUMENT BOX OVER MONUMENT.

N28°E, 31.25 FT. SET 1/2" REROD IN GRAVEL SHOULDER
S88°E, 43.07 FT. SET T.C. REMON TAG IN NORTH FACE OF RAILROAD TIE POST
S35°E, 30.14 FT. SET 5/8" RE-ROD IN GRAVEL SHOULDER
S85°W, 49.89 FT. SET T.C. REMON TAG IN SOUTH FACE OF POWER POLE
WEST, 33.44 FT. SET T.C. REMON TAG IN NORTH FACE OF WOOD POST

NOTE: THIS CORNER IS COMMON WITH CORNER A 8 T14N R10E (ELMWOOD TOWNSHIP)

Signed by Lionel Roy Emery
Surveyor's Michigan License No. 24593

Date DECEMBER 18, 1998

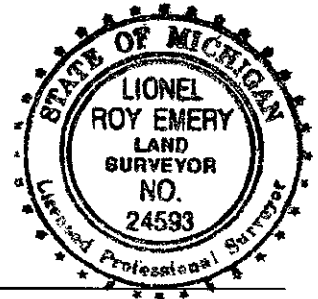

APPROVED 12-9-98
[Signature]

SURVEY &
REMONUMENTATION

MAR 02 1999

SECTION

