

DEC 07 1994

COMMISSION

1994 REMONUMENTATION PROGRAM  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in ELKLAND TOWNSHIP

RECEIVED FOR-RECORD  
LIBER NO. \_\_\_\_\_ PAGE NO. \_\_\_\_\_  
FILING NO. #35  
ELKLAND TWP.  
94 NOV -9 PH 2: 15

VIRGINIA M. McLAREN  
TUSCOLA COUNTY  
REGISTER OF DEEDS

**COPY**

Register of Deeds Stamp & File Number

TUSCOLA <small>(County)</small>	Located in:	Corner Code #/
1. Public Land Survey	T 14N R 11E	M-4
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

A	B	C	D	E	F	G	H	I	J	K	L
2	6	5	4	3	2						
3											
4	7	8	9	10	11						
5											
6	18	17	16	15	14						
7											
8	19	20	21	22	23						
9											
10	30	29	28	27	26						
11											
12	31	32	33	34	35						
13											

I, Lionel Roy Emery, in a field survey on July 29, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

1835 (Gov't. Land Office Notes) Harvey Parke, D.S. -Set qr. Sec. post- Cedar 7 S12W 16; Beech 10 N27W 14

No record of subsequent restoration.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


Found nothing marking original corner.

Restored by single proportion measure.

Corner position falls in centerline of North-South gravel road and in line with fence line remnants to the East.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed Standard Tuscola County Concrete Monument with 2" Brass Cap stamped M4 T14N/R11E  
N50°E, 35.18' -T.C. Re-mon. tag in Northwest face of 6" Poplar.  
S72°E, 32.65' -T.C. Re-mon. tag in South face of 5" Poplar.  
S25°W, 24.31' -set 1/2" diameter reinforcing rod.  
N10°W, 81.26' -T.C. Re-mon. tag in Northeast face of 12" Apple tree.

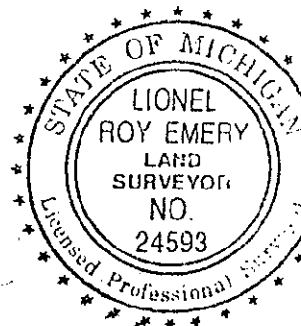

Signed by Lionel Roy Emery

Date Oct. 24, 1994

Surveyor's Michigan License No. 24593

APPROVED 1400  
10-20-94 970  
Q-10-1

COPY

