_____, Recorded Plat __

\$ 4.00 REHUMAMENTATION

8	DEC	7 5	9:43	A.M.	MECEIPIN 6	1

For corners in

5 Private Claims

City of Dearbard 05 1996 LAND CORNER RECORDATION CERTIFICATE COMMISSION Requirement of Act 74, Mich. P.A. 1970


usik tren. M

\$ 7,00 DEFT <u>Wayne</u> Located In: Corner Code ## LIBER 28451 PAGE 02 T 2S R 10E C-13 1. Public Land Survey Compliance with ____ R _ ACT 345, P.A. 1990 T _____ R __ APPROVED ON: 12-6-95 ____R _ T _ 2. Property Controlling WAYNE COUNTY REMONUMENTATION ____ T ____ R ____ in Section PEUR CROUP COMMITTEE ___ T ____ R ____ Miscellaneous

Register of Deeds Stamp & File Number Property in Sec.

Lawrence R. Feindt , in a field survey on November 30 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

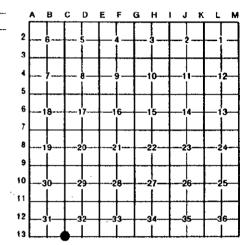

A. Description of original monument and accessories and/or subsequent restoration:

C-13) South Corner Common to Sections 31 & 32, T 2 S, R 10 E WAYNE COUNTY BUREAU OF TAXATION GENERAL LAND OFFICE SET POST FOR CORNER IRON NNE'LY-125.46'-15"MAPLE SSE'LY- 64.95'-MONUMENT SW'LY - 60.15'-CROSS E. COR. SIGN POST IRONWOOD 10"-N46 W-16 LINKS(10.56')
BLACK OAK 12"-N04 E-33 LINKS(21.78')

DECEMBER 16, 1816 NW'LY - 55.71'-TELEPHONE POLE BY: JOSEPH FLETCHER, DS

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-13) South Corner Common to Sections 31 & 32, T 2 S, R 10 E Found 1/2" pipe in monument box. Distance to D-13 measured 2626.27' (WPA = 2626.25'). Distance to B-13 measured 2630.36' (WPA = 2630.39'). Corner was confirmed with irons found in "Rougelvania Subdivision No. 1" as recorded in Liber 55 of Plats, Page 33. Monument also has been used as the corner common to Sections 5 & 6, T 3 S, R 10 E (C-1) as documented by local plats and the WPA notes. GLO notes indicate the corner common to Sections 5 & 6 to be 20 links (13.2') west of the corner common to Sections 31 & 32. No evidence of C-1 of T 3 S, R 10 E was found.



C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-13) South Corner Common to Sections 31 & 32, T 2 S, R 10 E Found 1/2" pipe in monument box at the intersection of Beech Daly Road and Van Born Road, and placed Wayne County brass disk stamped with license #21566 over pipe. Road surface is asphalt over concrete. Corner is accepted as a careful and faithful reestablishment of the position of the original corner.

S43°E - 85.48' - Northwest corner of building #25757 S56°W - 73.82' - Set chiseled "X" in top center of fire hydrant N46°W - 62.48' - Set nail & #21566 cap in SW face of utility pole N57°E - 87.23' - Set chiseled "X" in top center of fire hydrant

Laurence R. December 7, 1995

Surveyor's Michigan License No. 21566