

MAR 3 1 1994

RECEIVED

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

1993 DEC -2 PM 3:51

COMMISSION

For corners in  
WEXFORD

(County)

Located In:

Corner Code #

1. Public Land Survey	T	21N	R	10W	J-13
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S		T	R	
	S		T	R	
3. Miscellaneous Property in Sec.	S		T	R	
	S		T	R	

*Linda Longmiller*  
WEXFORD COUNTY, MI  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, CRAIG J. PULLEN, in a field survey on OCTOBER 13, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:


**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

- J-13 1837 GLO SURVEY, WOOD POST CEDAR 12" N55°W 16 LKS. BIRCH 10" N77°E 18 LKS.
- 1900± E. E. SOURS SURVEY, 3" CEDAR STAKE IRONWOOD 9 N37°45'W 29' CEDAR STUMP 10" N49°30'E 53'.
- 1974 J. ERICKSON SURVEY, CORNER RECORDED IN L.2, P.674. SET IRON PRORATED DISTANCE FROM SURVEY IN W.C.R.C. RECORDS 1.0' NORTH OF BIT. CENTERLINE N25°W P. POLE 37.48' S35°W 4" CEDAR IN CLUMP 34.37' N25°E 20" PINE 36.75'.
- 1991 C. ROSER SURVEY, CORNER RECORDED IN L.4, P.99. FOUND 5/8" IRON PER J. ERICKSON SURVEY (1974). 8" CEDAR S30°E 43.30' 9" HEMLOCK IN CLUMP 4 S25°W 51.32' P. POLE N25°W 37.58' 24" W. PINE N25°E 86.39' CENTER DRIVEWAY DUE W 5' NE 3, T20N, R10W N89°05'E 439.47'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J-13 FOUND 5/8" IRON 1.0' NORTH OF CENTERLINE BIT. ROAD AND WITNESSES RECORDED IN L.4, P.99 INTACT. CAPPED EXISTING 5/8" IRON WITH BRASS GAP. THIS CORNER IS ACCEPTED AS A CAREFUL AND FAITHFUL PERPETUATION OF THE POSITION OF THE ORIGINAL CORNER.

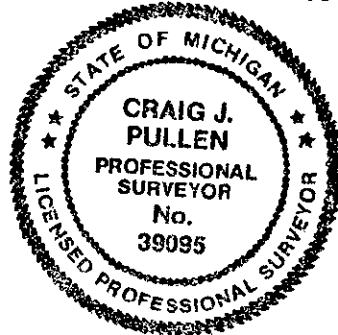

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J-13  
5/8" X 36" IRON WITH WEXFORD CO. BRASS CAP STAMPED: ¼, 35, PS 39095, 1993  
S30°E 8" CEDAR 43.30'  
S25°W 9" HEMLOCK IN CLUMP 51.32'  
N25°W POWER POLE 37.58'  
N25°E 30" WHITE PINE 86.39'  
WEST CENTERLINE EXTENDED OF DRIVEWAY 5'

Peer Group Reviewed and Approved  
Date: Nov. 29, 1993  
*Richard D. Wilcox*  
Richard D. Wilcox, Wexford County Surveyor

Signed by Craig J. Pullen Date NOVEMBER 23, 1993  
Surveyor's Michigan License No. 39095