

SURVEY & REMONUMENTATION

FEB 11 1998

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Wexford
(County)

Located In:

Corner Code #

- | | | |
|------------------------------------|-----------------------------|-------|
| 1. Public Land Survey | T <u>21</u> N R <u>12</u> W | M-3 |
| | T ___ R ___ | _____ |
| | T ___ R ___ | _____ |
| | T ___ R ___ | _____ |
| 2. Property Controlling in Section | S ___ T ___ R ___ | _____ |
| | S ___ T ___ R ___ | _____ |
| 3. Miscellaneous Property in Sec. | S ___ T ___ R ___ | _____ |
| | S ___ T ___ R ___ | _____ |

RECEIVED

1997 DEC 11 AM 9:30

Linda Laughmiller
WEXFORD COUNTY, MI
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, George Smith, in a field survey on July 7, 19 97 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		10		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

- M-3) 1837 GLO Section Post by John Brink, Deputy Surveyor; Hemlock 18 S29°W24; Beech 10 N19°W24
- 1907 D. E. Teed Survey, Liber 1, Page 108, found stake and witnesses by A.J. Teed in book 77, page 41
- 1909 Fargo Eng. CO. Survey notes, no US evidence, found and accepted stake, set 1" iron pipe Maple 12" N50°W 50 3/4 links, Double Maple 12" N45°E 75 3/4 links
- 1973 Griffin RLS #13584 LCRC (field survey in 1966), Liber 1, Page 400. Re-established section corner by 1 witness from Fargo survey, set 5"x3" conc. mon. with 3" Brass Disk, stamped T21N, R12W, R11W, S1, S6, S12, S7, 1966 RLS #13584, 16' E of centerline of pavement, center of Twin Maple 22" N45°E 50' (Fargo Bearing Tree)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- (A continued) Red Pine S22°E 77.07' set 10" dock spike
- Red Pine N50°W 87.80' set 10" dock spike
- Red Pine S67°W 92.85' set 10" dock spike
- 6" x 7' Cedar Post East 33'
- 1992 Wade-Trim/Granger Certificate of Survey by James A. Ray PS#25869, found USFS mon.
- N55°E Sign Post 35.35'
- S20°E 12" Red Pine 76.95'
- S65°W 12" Red Pine 92.90'
- West Centerline Road 15.5'

B.) Found U.S.F.S. mon. with 3" brass disk and 3 witnesses from Griffins LCRC. This corner is accepted as the best available evidence of the position of the original corner, being the section corner common to Sections 1 and 12, T21N-R12W and Section 6 and 7, T21N-R11W


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

USFS mon with 3" brass disk stamped T21N-R12W, R11W, S1, S6, S12, S7, 1966 RLS #13584, ±16' East of centerline
N55°E 35.35' Sign post
S20°E 77.02' Found nail in 20" R. Pine
N45°W 87.75' Found nail in 20" R. Pine
S65°W 92.76' Found nail in 14" R. Pine

Peer Group Reviewed and Approved

Date: 30 Oct 97
Richard D. Wilcox
Richard D. Wilcox, Wexford County Surveyor

Signed by _____
Surveyor's Michigan License No. _____

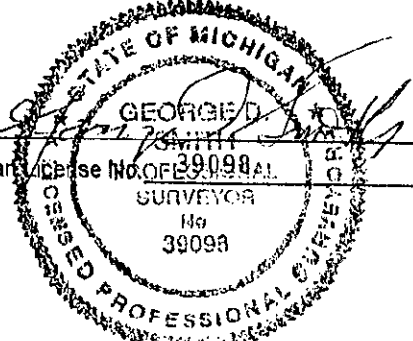

Date 10-30-97